



Village of Norridge

Initial Lead Service Line Replacement Plan

REL Project 22-R0901

April 15, 2024



Table of Contents

1.0	Overview.....	1
1.1	Introduction	1
2.0	Background Information.....	1
2.1	Location	1
2.2	Community Water Supply (CWS).....	1
3.0	Lead Service Line Inventory (LSLI).....	1
3.1	Summary.....	1
3.2	Previous Replacements.....	2
4.0	Funding Considerations	3
4.1	Federal & State Funding Sources.....	3
4.1.1	IEPA State Revolving Fund (SRF).....	3
4.1.2	Illinois Department of Commerce and Economic Opportunity (DCEO) Grant.....	4
4.1.3	HUD Community Development Block (CDB) Grant.....	4
4.1.4	Congressional Discretionary Funding.....	4
4.2	Revenue-Generating Funding Sources	4
4.2.1	Increased Local Sales Tax	4
4.2.2	Resident Cost Sharing	4
4.2.3	Water Rate Increase	5
4.2.4	Increase of Other Tax Sources	5
4.3	Potential Funding.....	5
4.4	Financial Plan.....	5
5.0	Prioritization.....	5
5.1	Risk Factors.....	5
5.2	Prioritization Factors by Vermont Department of Environmental Conservation	5
5.3	Emergency Work-related Lead Service Line Replacement (EW-LSLR).....	6
6.0	Lead Service Line Replacement (LSLR)	7
6.1	Scope of LSLR	7
6.2	Replacement Methods	7
6.3	Completed LSLR.....	8
7.0	Workforce Development.....	8
8.0	Resident Communication and Outreach.....	10

Appendices

Appendix 1	Code of Ordinances
Appendix 2	Complete Lead Service Line Inventory
Appendix 3	Building Age Map
Appendix 4	Water Rates
Appendix 5	LSLR Details
Appendix 6	Lead Service Line Replacement Outreach Materials

Norridge

1.0 Overview

1.1 Introduction

The Lead Service Line Replacement and Notification Act (Act), State of Illinois Public Act 102-0613, went into effect on January 1, 2022. This Act required that every owner or operator of a community water supply (CWS) that has known or suspected lead service lines (LSLs) create a plan to replace each lead and galvanized service line (if connected downstream of lead piping); submit that initial plan to the Illinois Environmental Protection Agency (Agency) by April 15th, 2024; submit by April 15th of each year after 2024 until 2027 an updated lead service line replacement plan to the Agency; and submit by April 15th, 2027 a final lead service line replacement plan to the Agency. The Act also requires that the plan is posted on the community water supply's website.

The Act also requires that the plan is posted on the community water supply's website. This Plan will be available on the Village's website until April 15, 2025, at which time it will be replaced with an updated Plan.

The Village of Norridge has prepared an initial Lead Service Line Replacement Plan (Plan) in compliance with the Act and its requirements. The Plan includes the name and identification number of the CWS; an inventory of the total service lines, known and suspected LSLs, and LSLs that have been replaced since 2020; a proposed replacement schedule; a cost analysis with financing options; a prioritization plan; community outreach measures; and workforce development measures.

2.0 Background Information

2.1 Location

The Village of Norridge is located in Cook County in northeastern Illinois approximately 14 miles northwest of downtown Chicago in Cook County, IL. The Village is bounded by Harwood Heights to the east, and Chicago to the north, south and west. The Village corporate boundaries encompass an area of approximately 1.81 square miles.

2.2 Community Water Supply (CWS)

The Community Water Supply (CWS) is named Norridge and is IEPA Water System No. IL0312040. The CWS serves a population of 14,281 and has 5,125 service connections as reported to the IEPA and posted to Illinois.gov under the Illinois Drinking Water Watch.

The CWS takes ownership of the service line extending from the water main to the water shut-off valve or Buffalo Box (b-box)/curb stop while the property owner takes ownership of the service line from the water shut-off valve or Buffalo Box (b-box)/curb stop according to the Village's Code of Ordinances, listed in Appendix 1.

3.0 Lead Service Line Inventory (LSLI)

3.1 Summary

The definitions of water service line materials in the CWS's inventory adheres to the definitions provided by the Illinois EPA. These definitions are outlined in the table below.

Service Line Material
Copper – No Lead Solder (C)
Galvanized Requiring Replacement (GRR)
Lead (L)
Cast/Ductile Iron (O)
Unknown (U)

Unknown Not Lead (UNL)

The CWS has made ongoing efforts to complete its inventory. These efforts include those listed below: reviewing resident surveys, water meter replacement records, a property's building age, exploratory excavations at targeted locations, visual inspection of interior service lines, and predictive modeling for properties without known material type.

- **Building Age:** For those buildings constructed after 1988, service lines are assumed to be non-lead on both the public and private sides.
- **Historical Records:** Where available, historical records were used to identify service line material. Historical records could include water meter replacement records, water main replacement records, water main tapping cards, water meter cards, permit records, and documentation from maintenance and repairs.
- **Visual Identification:** The CWS staff recorded service line material when entering private property.
- **Resident-Provided Photos:** The CWS distributed a survey in which residents could provide photos of their service line. A sample survey mailer is included in Appendix 6. Trained staff identify the service line material based on the photos and the photo and material are recorded and saved on the CWS GIS.
- **Exploratory Excavations:** Very few records contain information on the public-side service line material. A contractor excavated in the parkway to determine public-side material at select locations to determine lead density throughout the service area.
- **Predictive Modeling:** Those addresses for which there are no historical records or survey responses to verify the private side of the material and are within the time period in which lead services were installed were included in a machine learning predictive model that correlates service line material to building characteristics. Any addresses that have a greater than 50% chance of having a lead service is considered suspected lead on the inventory spreadsheet.

The current inventory includes:

- The total number of services lines in the CWS for the current year;
- The material composition of each service line in the CWS's distribution system;
- The count of suspected lead service lines identified since the last inventory submission;
- The number of suspected or known lead service lines replaced since the last inventory submission

A copy of the inventory submitted to the Agency that lists the total number of service line connections, total LSLs, and total suspected LSLs is included in Appendix 2. A map of the building ages in the CWS is included in Appendix 3. Buildings built prior to 1970 have a higher probability of having a lead service.

Service Material	# of Services		
	Private	Public	Entire Service Line
Lead (L)	49	44	50
Unknown Suspected Lead (U)	208	180	208
Galvanized Requiring Replacement (GRR)	6	5	0
Not Lead	4,548	4,574	4,586

3.2 Previous Replacements

The CWS has not begun replacing lead and galvanized service lines.

4.0 Funding Considerations

The funding sources for the Lead Service Line Replacement (LSLR) Program will be considered and evaluated in this section. A proposed funding plan to meet the requirement to complete the LSLR within the fifteen (15) year replacement timeframe will be presented.

Based on an inventory of 258 LSLs and a replacement cost of \$11,000, the CWS will need \$2,838,000 to fund the LSLR Program. The CWS will likely use a combination of the funding sources described in this section. With a mandated replacement rate of 7%, the CWS will plan to replace 18 LSLs annually at a projected cost of \$198,000.

4.1 Federal & State Funding Sources

Other possible funding sources would be periodically evaluated for favorability and affordability. These funding sources could include:

- Illinois Environmental Protection Agency (IEPA) State Revolving Fund Loan Program (SRF)
- Illinois Department of Commerce and Economic Opportunity (DCEO) Grants
- HUD-administered Community Development Block Grant (CDBG)
- Congressional Discretionary Funding
- United States Environmental Protection Agency (USEPA) Community Change Grants
- LeadCare Cook County
- Rebuild Illinois Program

4.1.1 IEPA State Revolving Fund (SRF)

The Bipartisan Infrastructure Act reserved \$15 billion in funding for LSLR in the United States over five years. To date, the State of Illinois has received \$337.1 million in the first two years of funding. The amount of funding reserved for LSLR in the State of Illinois for the next three years is unknown. This funding is available as low-interest and forgivable loans allocated through the Illinois EPA SRF loan program.

The IEPA SRF loan program awards loans according to census tract scoring that considers demographic information that will be discussed in more detail in the Prioritization section. A preliminary census tract ranking system was developed with available census data and 2023 inventory information. The ranking may change with updates to the census demographic data or with any changes in the number and density of lead services. This ranking system is developed using the best available knowledge and will be updated annually with new information.

For planning purposes, the CWS will assume that it receives forgivable loans for LSLR in census tracts with a combined score higher than 300 and 0% interest loans for LSLR in census tracts with a combined score higher than 250.

Census Tract	Score	Rank	LSLs
Census Tract 7709.02, Cook County, Illinois	140	5527	3
Census Tract 8105.01, Cook County, Illinois	145	5288	43
Census Tract 8105.02, Cook County, Illinois	130	5975	9

Current estimates suggest that the SRF loan program could provide 0% interest loans for 55 LSLRs within the CWS, which accounts for 21% of the CWS's LSLRs. The funding related to these replacements is estimated to be approximately \$605,000.

4.1.2 Illinois Department of Commerce and Economic Opportunity (DCEO) Grant

The Office of Community Development supports economic development, community development, and infrastructure improvements in Illinois communities with substantial low-to-moderate-income populations. Various DCEO grants can be used for LSLR funding. The CWS will periodically review available grants.

4.1.3 HUD Community Development Block (CDB) Grant

The Office administers the federally funded Community Development Block Grant (CDBG) program that assists low-income populations. LSLR Programs are eligible for CDBG funding in qualifying areas. The CWS will evaluate their eligibility for CDBG funding.

4.1.4 Congressional Discretionary Funding

Each member of the United States Congress receives an allotment of grant funding to be used at their discretion annually. While no funding has been awarded and it is unlikely that Congressional Discretionary Funding will be a significant source of funding, this source of funding is still an option to fund a portion of a project.

4.2 Revenue-Generating Funding Sources

The local and direct revenue generating methods that are evaluated in the Plan are:

- Increased local sales taxes
- Resident cost sharing
- Water rate increase
- Increase of other taxes

The proposed taxes and fees would be continuous revenue sources set at rates to meet the mandated annual LSLR rate.

4.2.1 Increased Local Sales Tax

Communities, counties, and sports authorities have imposed a modest sales tax increase over a determined period of time to generate revenue from the constituents that benefit from the proposed improvement.

The Village of Norridge municipal Sales Tax generated \$5.57 million in FY22. The sales tax rate for retail sales in Norridge is:

Illinois	6.25%
Cook County	1.75%
Norridge	1.50%
Regional Transport Authority	1.00%
	10.50%

Therefore, if the Norridge Municipal Sales Tax were increased 0.25%, an additional \$0.928 million ($0.25/1.5 \times \5.57 million) would be available annually for LSLR. If the tax were increased 0.50% then \$1.85 million could be available annually for LSLR. An increase in local sales tax could fund 84 or 168 LSLRs annually, respectively.

4.2.2 Resident Cost Sharing

Resident cost sharing is another revenue-generating method that shares the cost of replacement with those whose properties are affected. A cost sharing program that includes a \$25/month replacement charge on the water bill for twenty years would generate \$300 per LSLR per annum and \$6,000 over the repayment period. This repayment amount covers the approximate cost of the private side of the replacement while remaining affordable for affected water customers.

The CWS will evaluate this method based on affordability and ease of implementation. This method would require the ability to tie the cost sharing to the property title so that it transfers with any change of property ownership. This method is also more feasible when the intent is to cover annual loan repayments versus the total construction cost for that year.

4.2.3 Water Rate Increase

The CWS can consider raising rates to fund the LSLR Program. The rate increase will be evaluated for affordability and for its ability to fund the Program. A rate increase of 5% would generate an additional \$139,000 annually from the \$2.782 million generated in fees in FY22. The current water rates are included in Appendix 4.

4.2.4 Increase of Other Tax Sources

Besides sales and property taxes, the State of Illinois has about twenty-six other revenue sources as taxes, fees, assessments, license fees, lottery, use fees, transfer tax and user fees ranging from Automobile Renting Occupation and Use Tax to Video Gaming Tax and License Fee. The time to enact a tax in any form to fund the LSLR is prohibitive and the likelihood of enactment is very low, based on existing taxes. Additional revenue from State funding or from Federal sources into a State administered fund is not guaranteed.

4.3 Potential Funding

The CWS could use a combination of any of the methods discussed above to generate sufficient funds to cover the replacement costs. However, it is the intent of the CWS to maximize grants and forgivable loan awards to cover LSLR costs.

4.4 Financial Plan

The CWS will consider all funding sources listed above. The financial plan, like the other elements of the Plan, is a living document and can change as the availability of funding changes. Currently, the CWS plans to take advantage of the SRF loan program to fund the next four years of replacements.

The CWS will continue to develop a financial plan for future replacements as more information on the inventory, bidding environment, and funding is gathered.

5.0 Prioritization

Since the number of LSLs in the system exceeds the number of replacements the CWS can afford in a single year, the LSLR Program must include an element of prioritization. The CWS will follow the mandated replacement rate of 7% or 18 LSLs per year for 15 years laid out in the Act. The CWS will prioritize replacement project areas based on risk factors and planned companion infrastructure projects.

5.1 Risk Factors

The population most at risk of exposure to lead and with the highest health risks when exposed is children and seniors in disadvantaged areas. The IEPA SRF loan program incorporates census data for median household income, children under the age of 6, unemployment rate, poverty rate, social security rate, and supplemental security income to prioritize at-risk populations. The CWS will use the IEPA SRF scoring system to prioritize those areas with the most at-risk populations.

The CWS will also prioritize replacements in high-risk facilities such as daycares, schools, parks, hospitals, and nursing homes.

5.2 Prioritization Factors by Vermont Department of Environmental Conservation

When the service area of the CWS with the same level of risk contains more lead services than can be replaced in a year, the CWS will consider companion infrastructure projects such as water main replacements, water meter replacements, and road resurfacing projects when prioritizing each year's project area.

The Vermont Department of Environmental Conservation developed a prioritization rubric as a standard and transparent method for determining replacement order according to the factors discussed. The table below lists the prioritization factors and priority points as recommended by the Vermont Department of Environmental Conservation and then the priority points developed by the CWS to account for the Illinois-specific requirements of the Act and IEPA SRF-funding.

As each LSL is identified and categorized with any possible number of the prioritization factors listed below, the summation of the factors yields a prioritization points Score using the rubric, as a guide to scoring based on the criteria, as shown below.

Priority Points –	CWS /REL	Prioritization Factor	LCRR Requirement
-------------------	----------	-----------------------	------------------

Vermont Department of Environmental Conservation	Priority Points		
10	8	Known Lead Service Line	Required
10	80	Populations Most Sensitive to the Effects of Lead <ul style="list-style-type: none"> • Schools and Day Care Facilities • Homes with children and/or adults who are pregnant or may become pregnant 	Required
10	10	Disadvantaged Communities	Required
8	8	Known GRR Service Line	Required
5	2	Populations Most Sensitive to the Effects of Lead <ul style="list-style-type: none"> • Nursing Homes • Medical Facilities 	Not Required
5	8	Companion Projects (concurrent infrastructure projects)	Not Required
5	8	Compact Projects (concurrent project in the same area)	Not Required
3	8	Long Length Lead Pipe Projects (or high lead results)	Not Required
2	6	Other Factors Listed in ANSI/AWWA C810-17 § II.A. <ul style="list-style-type: none"> • Service lines physically disturbed by digging, excavation, repair, or other activities • Existing partial lead service line replacements • Consideration of presence of lead goosenecks or pigtails 	Not Required
N/A	20	Funding Eligibility	Not Required
N/A	5	LSL Density	Not Required
1	5	Other Factors Significant to the Water System	Not Required

5.3 Emergency Work-related Lead Service Line Replacement (EW-LSLR)

LSLR instances arising from breaks or leaks on the public side of the service line are completed under this program. Upon notification of a break or leak from the customer, the Water Department dispatches a crew to assess the location and feasibility of repair. Subsequently, an EW-LSLR is initiated to replace the affected lead service. Private-side breaks or leaks are not covered under this program.

6.0 Lead Service Line Replacement (LSLR)

6.1 Scope of LSLR

The work shall consist of the removal and replacement of lead or galvanized iron water services for buildings within the specified service area. The area will be determined based on prioritization, material, building age, and funding limits, but all will be within the corporate boundaries of the CWS. New copper service lines shall be installed for full and partial lead service line replacement. Full lead service line replacement shall be defined as connecting from the water main to inside the building. Partial service line replacement shall be defined as connecting from the curb box (B-box or buffalo box) to the water main. No lead piping will be left in the water system. Partial replacements will only occur where the existing service is partially lead or galvanized. Cross-sectional replacement details are included in Appendix 5.

6.2 Replacement Methods

The methods of installing the new service are described below. To minimize impacts to residential property and to reduce restoration, trenchless methods are preferred.

Open cut: Open cut trenching is the typical method used by plumbers, especially for properties slated for demolition and replacement. It involves digging a trench, which can cause significant exterior disruption to property owners. Interior disturbances depend on whether the basement is finished. Despite its disturbance, open cut trenching is often the most cost-effective option, particularly when restoration costs are minimal. This approach is only advised based on individual circumstances.

Trenchless: Trenchless installation of water services is being explored to address concerns such as economic impact, landscape disruption, and social inconveniences associated with traditional open cut methods. Advances in trenchless technologies offer a more efficient alternative in certain situations, minimizing surface disruption and restoration time. These methods are socially appealing as they cause less destruction and require less restoration compared to open cut techniques.

Standard Horizontal Directional Drilling: Standard Horizontal Directional Drilling (HDD) involves using a drill rig on the ground surface to create a tunnel underground. To reach a depth of about 5'6" below the ground surface, the drill rig head must be positioned approximately 30 feet away from the final depth point of the water service. This may require closing the road for safety. While many pipeline and cable contractors employ this method, plumbing contractors often subcontract it out as specialty work.

Pipe pulling: Pipe pulling is the most cost-effective method among trenchless options for installing water services. It involves using the path of the existing pipe, eliminating the need for additional excavation. A new water service pipe is pulled along the existing route, often with a winch or excavator bucket with a cable. The new copper service is connected to the existing lead service in the home, effectively replacing it using the borehole left by the removed lead pipe.

The connection to the water main typically incorporates the use of a tapping sleeve and is done by a licensed plumber. The licensed plumber also connects the new service line to the existing water meter inside the house according to the State of Illinois plumbing code.

Prior to completion of the work, the Contractor shall provide each address that received a new service line with a Point of Use water filter that meets both NSF/ANSI 42 and 53 certifications for lead reduction with a minimum capacity of 0.5 gallons and six months of replacement cartridges or a minimum of 150 gallons of filtration capacity. The filter shall not be a permanent faucet filter. The Contractor shall have the resident provide a signature to acknowledge receipt of the filter on a form provided by the Village. The form shall be turned in with other documentation.

Prior to beginning the work of connecting the new service inside the house, the water supply to the service line and the property owner shall be shut off to avoid release of particulate lead into the property owner's premises. After all connections have been completed, the Contractor shall flush the water from an outside connection (such as a hose bibb or hose leading from the building side of the meter) to remove any particles in the service line. Flush at full velocity for at least 30 minutes. The Contractor shall then advise the property owner to flush the interior premise plumbing in accordance with the instructions

provided in the Owner-provided informational material. This work shall be conducted in accordance with AWWA C810-17 – Replacement and Flushing of Lead Service Lines.

The Village will use these standards when performing lead service line replacement:

Item	Condition
1. Restoration of Interior and Exterior	Meet existing condition or better
2. Parkway/Yard Restoration	Sod, Seed in Summer
3. Field Locate B-boxes	Location by Village
4. Trench backfill	CA-7
5. Verify B-box operation at Project Completion – after surface restoration	B-boxes keyed by Village
6. Street Cross Sections	Minimum 6-inch pavement patching
7. Work Hours	Monday to Friday 7 am to 7 pm Saturday 8 am to 7 pm No Work Sunday or Holidays, except Contractor my Schedule meeting/inspection at buildings on Sunday.
8. Meter Pits	Village will be consulted prior to relocating meter to building interior and abandoning the meter pit. Contingency Pay Item for this work included in contract.
9. B-box	Mueller H-10302, Minneapolis Pattern or approved equal
10. Curb stop	Mueller Ball Style: H15150 or approved equal
11. Corp Stop	Mueller H-15000 or approved equal
12. Saddle for corp stop	Smith-Blair or Ford Repair Clamp
13. Abandon existing Lead Service Line	Cap.

6.3 Completed LSLR

The CWS has not completed any lead service line replacement projects.

7.0 Workforce Development

In performing projects associated with the Lead Service Line Replacement initiative, the CWS plans to develop the workforce available to perform these projects. These developmental practices include:

Smaller bids: The CWS will break the required replacements into smaller projects within the CWS, so that the bids will be smaller and more attainable for smaller firms.

College engagement: The CWS will engage with local colleges and institutions to train new individuals entering the workforce.

Hiring local: The CWS will include a clause within the scope of work for interior work and inspections to be conducted by local contractors who have an understanding of the community.

Experience contractor teaching: An experienced contractor teaches a smaller contractor how to perform the work.

Diversity in hiring practices are another aspect to workforce development and would include contacting all local MBE and WBE contractor associations during bidding.

The Contractor shall also take the following specific affirmative action to ensure equal employment opportunity:

- Ensure and maintain a working environment free of harassment, intimidation, and coercion at all sites, and in all facilities at which the Contractor's employees are assigned to work. The Contractor, where possible, will assign two or more women to each construction project. The Contractor shall specifically ensure that all foremen, superintendents, and other on-site supervisory personnel are aware of and carry out the Contractor's obligation to maintain such a working environment, with specific attention to minority or female individuals working at such sites or in such facilities.
- Establish and maintain a current list of minority and female recruitment sources, provide written notification to minority and female recruitment sources and to community organizations when the Contractor or its unions have employment opportunities available, and maintain a record of the organizations' responses.
- Maintain a current file of the names, addresses and telephone numbers of each minority and female off-the-street applicant and minority or female referral from a union, a recruitment source or community organization and of what action was taken with respect to each such individual. If such individual was sent to the union hiring hall for referral and was not referred back to the Contractor by the union or, if referred, not employed by the Contractor, this shall be documented in the file with the reason; therefore, along with whatever additional actions the Contractor may have taken.
- Provide immediate written notification to the Director when the union or unions with which the Contractor has a collective bargaining agreement has not referred to the Contractor a minority person or woman sent by the Contractor, or when the Contractor has other information that the union referral process has impeded the Contractor's efforts to meet its obligations.
- Develop on-the-job training opportunities and/or participate in training programs for the area which expressly include minorities and women, including upgrading programs and apprenticeship and trainee programs relevant to the Contractor's employment needs, especially those programs funded or approved by the Department of Labor.
- Disseminate the Contractor's EEO policy by providing notice of the policy to unions and training programs and requesting their cooperation in assisting the Contractor in meeting its EEO obligations; by including it in any policy manual and collective bargaining agreement; by publicizing it in the company newspaper, annual report, etc.; by specific review of the policy with all management personnel and with all minority and female employees at least once a year; and by posting the company EEO policy on bulletin boards accessible to all employees at each location where construction work is performed.
- Review, at least annually, the company's EEO policy and affirmative action obligations under these specifications with all employees having any responsibility for hiring, assignment, layoff, termination, or other employment decisions including specific review of these items with onsite supervisory personnel such as Superintendents, General Foremen, etc., prior to the initiation of construction work at any job site. A written record shall be made and maintained identifying the time and place of these meetings, persons attending, subject matter discussed, and disposition of the subject matter.
- Disseminate the Contractor's EEO policy externally by including it in any advertising in the news media, specifically including minority and female news media, and providing written notification to and discussing the Contractor's EEO policy with other Contractors and Subcontractors with whom the Contractor does or anticipates doing business.
- Direct its recruitment efforts, both oral and written, to minority, female and community organizations, to schools with minority and female students and to minority and female recruitment and training organizations serving the Contractor's recruitment area and employment needs. Not later than one month prior to the date for the acceptance of applications for apprenticeship or other training by any recruitment source, the Contractor shall send written notification to organizations such as the above, describing the openings, screening procedures, and tests to be used in the selection process.

- Encourage present minority and female employees to recruit other minority persons and women and, where reasonable, provide after school, summer and vacation employment to minority and female youth both on the site and in other areas of a contractor's work force.
- Validate all tests and other selection requirements where there is an obligation to do so under 41 CFR Part 60-3.
- Conduct, at least annually, an inventory and evaluation at least of all minority and female personnel for promotional opportunities and encourage these employees to seek or to prepare for, through appropriate training, etc., such opportunities.
- Ensure that seniority practices, job classifications, work assignments and other personnel practices, do not have a discriminatory effect by continually monitoring all personnel and employment related activities to ensure that the EEO policy and the Contractor's obligations under these specifications are being carried out.
- Ensure that all facilities and company activities are non-segregated except that separate or single-user toilet and necessary changing facilities shall be provided to assure privacy between the sexes.
- Document and maintain a record of all solicitations of offers for subcontracts from minority and female construction contractors and suppliers, including circulation of solicitations to minority and female contractor associations and other business associations.
- Conduct a review, at least annually, of all supervisors' adherence to and performance under the Contractor's EEO policies and affirmative action obligations.

8.0 Resident Communication and Outreach

To ensure effective community engagement, the CWS's outreach program for the Lead Service Line Replacement (LSLR) initiative will employ various communication methods aimed at informing and involving homeowners. Central to the program's success is consistent and informative communication across multiple platforms, including meetings, press releases, door-to-door notifications, and social media channels. By leveraging these diverse communication channels, the program aims to raise widespread awareness about the significance of the LSLR program and the options available for homeowners to participate. Early successes of the program will be shared with the community to foster positive feedback and encourage support for the initiative.

To effectively communicate the goals and requirements of the LSLR program, a comprehensive outreach & communication plan is developed, outlining key messaging, target audiences, and preferred communication methods. Emphasis will be placed on building trust and transparency with homeowners, ensuring they understand the benefits of participating in the program. Notices will be sent to homeowners at least 45 days before the commencement of work, with repeated notifications every two weeks until confirmation of receipt. Special attention will be given to non-English speakers, providing translated notices and instructions for accessing additional resources. As previously mentioned, the Community Outreach and Public Engagement plan will be vast, consistent, and includes:

Stakeholder Identification: The CWS has Identified key stakeholders, including residents, local businesses, community organizations, schools, healthcare providers, and governmental agencies.

Educational Materials: The CWS is developing comprehensive educational materials explaining the importance of lead service line replacement, potential health risks associated with lead exposure, details of the replacement process, and available resources for assistance. The materials currently developed and used for LSLR outreach are added in Appendix 6.

Multi-Channel Communication: The CWS plans to utilize a variety of communication channels to reach different segments of the community, including:

Printed materials such as program brochures, flyers, door hangers and direct mail distributed to households, businesses, and public spaces.

Digital platforms including the village website, email newsletters, and community forums.

Information sessions and workshops held at community centers, schools, and other public venues.

Door-to-door outreach by trained community volunteers or outreach workers to engage directly with residents.

Social Media Channels: The CWS intends to utilize its social media platforms (**Facebook**) to engage with residents regarding lead exposure concerns. Posts will include links to informative resources on the CWS's website, as well as videos and webinars explaining lead risks and the CWS's efforts to mitigate them. Social media will also be used to announce upcoming project activities, public outreach events, and success metrics such as the percentage of lead pipes replaced.

Language and Accessibility: The CWS will ensure that all materials and communication efforts are available in multiple languages to accommodate the linguistic diversity of the community. Additionally, make information accessible to individuals with disabilities by providing alternative formats such as large print or audio versions.

Personalized Outreach: The CWS will tailor outreach efforts to specific demographics or neighborhoods within the service area, taking into account factors such as income level, age, cultural background, and housing status. Engage community leaders and influencers to help disseminate information and encourage participation.

Community Workshops and Events: The CWS has plans to organize community workshops, town hall meetings, and informational events where residents can learn more about the lead service line replacement program, ask questions, and provide feedback. Offer opportunities for hands-on demonstrations or tours of the replacement process and an avenue for public comment on the LSLR plans.

One-on-One Assistance: The CWS intends to provide personalized assistance and support to residents who may have questions or concerns about the replacement program. Establish a dedicated hotline or helpline staffed by knowledgeable personnel to address inquiries and provide guidance.

Feedback Mechanisms: The CWS plans to implement feedback mechanisms such as surveys, focus groups, or public hearings to gather input from residents throughout the planning and implementation phases of the program. Use this feedback to adjust and improvements as needed.

Collaboration and Partnerships: The CWS plans to collaborate with local organizations, community groups, schools, healthcare providers, and government agencies to amplify outreach efforts and leverage existing networks and resources.

Ongoing Engagement: The CWS will maintain ongoing communication and engagement with the community beyond the initial outreach phase. Provide regular updates on the progress of the replacement program, share success stories, and continue to address any concerns or issues that arise.

Non-Participation/Waivers: Homeowners in the CWS may not always be ready to engage with or communicate regarding the LSLR program. At present, the CWS lacks the authority to mandate homeowner access to private property or demand access for replacing the private side of the LSL. For those who choose not to participate, an Illinois Department of Public Health waiver form will be available. Efforts to communicate will be recorded for unresponsive homeowners.

Appendix 1

Code of Ordinances

Appendix 2

Complete Lead Service Line Inventory



Lead Service Line Inventory Template

*Please enter information in the empty box next to each section	Water System Name					Norridge			System ID Number:		ILO312040		Current Inventory Date:		4/15/2024			
*Please enter totals in the empty box next to each category	Total Service lines:	4844	Total Lead:	50	Total Non-Lead:			4586	Total Galvanized Requiring replacement:	0	Total Unknown:	208	Website link to Material Inventory:	gettheleadoutil.com				
Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Grooveneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property	
	EXAMPLES: Lead and Copper Sample site number is the 7 digit number starting with "L" or "LA". / If address is not a lead and copper sample site mark "N/A"			Yes (Y) or No (N)	What year was the PWS-Owned service line installed, if known?	What year was the customer side service line installed, if known?	How was the Material of this Service Line Identified?	EXAMPLES: Construction Records, Visual Inspections, Survey Response, Maintenance Records, etc...	EXAMPLES: Copper - No Lead Solder (C) Copper - Lead Solder (CLS) Galvanized (G) Lead (L) Cast/Ductile Iron or Transite (O) Plastic - PVC, HDPE, PEX (P) Unknown (U) Unknown Not Lead (UNL)	EXAMPLES: Copper - No Lead Solder (C) Copper - Lead Solder (CLS) Galvanized (G) Galvanized Requiring Replacement (GRR) Lead (L) Cast/Ductile Iron or Transite (O) Plastic - PVC, HDPE, PEX (P) Unknown (U) Unknown Not Lead (UNL)	EXAMPLES: Copper - No Lead Solder (C) Copper - Lead Solder (CLS) Galvanized (G) Galvanized Requiring Replacement (GRR) Non-Lead (NL)	EXAMPLES: Lead (L) Galvanized Requiring Replacement (GRR) Non-Lead (NL)	If any galvanized service line material was ever downstream of a Lead section, mark Yes (Y). If the galvanized service line material was never downstream of any Lead section, mark No (N). If Yes, that section of service line should be marked as Galvanized in the appropriate immediately preceding column(s).	Enter date customer was notified of Lead Service Line. / If Service Line is not Lead put N/R	If previous column was marked (Y), provide date the Lead Service Line was replaced. / Leave blank if previous column was (N).	EXAMPLES: Galvanized (G) Plastic - PVC, HDPE, PEX (P) Leave blank if no Lead Service Line was replaced.	Yes (Y) or No (N)	IF customer refused access to property, date waiver obtained by PWS or date PWS notified IDPH of refusal to sign waiver. / Leave blank if customer has not refused access.
4612 N ORIOLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4412 N OTTAWA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4020 N ORIOLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
5017 N ONEIDA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4940 N OVERHILL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4548 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
7846 W LAWRENCE AVE D	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4441 N OPAL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4508 N OSAGE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
5109 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4549 N OTTAWA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4338 N OVERHILL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4316 N SAYRE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4544 N ORIOLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4433 N OSAGE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4536 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4540 N ORANGE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
7508 W BELLE PLAINE AVE	N/A	N	2019	2019 HISTORICALRECORDWATERSYSTEMRECORD			UNL	C	C	NL	N	N/R	N			N		
4913 N ORANGE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
7241 W MONTROSE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
7115 W AGATITE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4844 N FRANK PKWY	LA3R064	N	N	2018 HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4251 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
7044 W WINDSOR AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4324 N OLEANDER AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4533 N OVERHILL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4441 N ORIOLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4124 N OVERHILL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4704 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4509 N ORANGE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
7649 W AINSLEY ST	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4111 N OKETO AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4713 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
7728 W SUNNYSIDE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4104 N OKETO AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4445 N ORIOLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4036 N ZARK AVE	N/A	N	2008	2008 HISTORICALRECORDWATERSYSTEMRECORD			UNL	C	C	NL	N	N/R	N			N		
7704 W WINDSOR AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
7724 W SUNNYSIDE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N		
4114 N OKETO AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N		
4935 N FRANK PKWY	N/A	N	N	2018 HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/OMWATERMAINREPAIRORREPLACEMENT			UNL	C	C	NL	N</							

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4214 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7732 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7729 W WILSON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4737 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4444 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4805 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7704 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4345 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4135 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7709 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4329 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4744 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8271 W STRONG ST	N/A	N	N	2019		2019 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4537 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7117 W AGATTE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7733 W WILSON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4849 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4656 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4845 N FRANK PKWY	N/A	N	N	2018		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/OMWATERMAINREPAIRORREPLACEMENT	UNL	C	C	NL	N	N/R	N			N	
4516 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4445 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4448 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4905 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7644 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4929 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4142 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7111 W AGATTE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4252 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7849 W LAWRENCE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4924 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4932 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4520 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7242 W PENSACOLA AVE	LP1A030	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4409 N OVERHILL AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7960 W EXECUTIVE CT	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4652 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4445 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4629 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4135 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4157 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7026 W MONTRÉO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4336 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4257 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5100 N LEONARD DR WS	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7656 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4110 S OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4440 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7725 W WILSON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4349 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4548 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4343 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4429 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4932 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4132 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4115 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4809 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7137 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4804 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5112 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL										

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4532 N OTTAWA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4137 N OKETO AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4346 N OTTAWA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4304 N NOTTINGHAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7923 W GUNNISON ST	N/A	N	N	2018 INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/OMWATERMAINREPAIRORREPLACEMENT			UNL	C	C	NL	N	N/R	N			N	
4947 N SUNRISE LN	N/A	N	N	2018 HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4047 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4108 N OSCEOLA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4644 N OPAL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4348 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4424 N OPAL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4712 N OVERHILL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4400 N ORANGE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4605 N ORIOLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4928 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4425 N CANFIELD RD	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7318 W CULLOME AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4312 N OLEANDER AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
5124 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4405 N ORANGE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4541 N OPAL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4816 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4229 N OKETO AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4432 N OVERHILL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4232 N OSCEOLA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7213 W PENSACOLA AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7947 W EXECUTIVE CT	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4149 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4033 N ODELL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7035 W SUNNYSIDE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4632 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4624 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7800 W STRONG ST	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4341 N NOTTINGHAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4653 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4017 N OLEANDER AVE	N/A	N	N	INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4331 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4933 N OZANAM AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4008 N OCTAVIA AVE	N/A	N	N	CONTRACTOR EXCAVATION			UNL	C	C	NL	N	N/R	N			N	
5129 N MORELAND DR	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8265 W MAPLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
5025 N RIDGEWOOD AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4906 N CLIFTON AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4200 N HARLEM AVE MM	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			U	O	O	NL	N	N/R	N			N	
8048 W GIDDINGS ST	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4444 N OVERHILL AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4628 N THATCHER AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4711 N THATCHER AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
8012 W GIDDINGS ST	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7813 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4859 N CUMBERLAND AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
5040 N RIDGEWOOD AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7414 W IRVING PARK RD	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			U	O	O	NL	N	N/R	N			N	
4500 N ORIOLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8649 W ARGYLE ST	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8048 W WINONA ST	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8118 W MAPLE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			U	L	L	L	N	08/26/2022	N			N	
4824 N LEONARD DR	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8313 W FOSTER AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N	</td			

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4637 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5173 N CANFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8317 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4229 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4126 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8327 W FARRAGUT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5016 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4044 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7444 W BERTEAU AVE	N/A	N	N	2010		2010 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4844 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4335 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4021 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4031 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5148 N MONTEREY DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4018 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4400 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4203 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4340 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7328 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5001 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8672 W AINSLIE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4054 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4636 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4124 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4516 N ORANGE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4038 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4307 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7725 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4301 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4901 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4445 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4404 N CANFIELD RD	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4621 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4704 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5025 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5153 N MORELAND DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8019 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4106 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4230 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4640 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4648 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4505 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4604 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4520 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4138 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8344 W FARRAGUT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4120 N OLcott AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4136 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4641 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4648 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4117 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4206 N OTTAWA AVE	N/A	N	N	2006		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4108 N ORIOLE AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4012 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4920 N LEONARD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4325 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7029 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4109 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4025 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4836 N GREENWOOD AVE	N/A	N	N</td														

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4901 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4939 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4237 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4330 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4136 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7306 W IRVING PARK RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5193 N MORELAND DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4850 N LEONARD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4516 N HARLEM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	U	O	O	NL	N	N/R	N			N	
4304 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4103 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4241 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4311 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7101 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7807 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4316 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8632 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7009 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4133 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4221 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4106 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4237 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4300 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4640 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4115 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4227 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7438 W BERTEAU AVE	N/A	N	N			OMWATERMAINEPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4800 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4026 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8017 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4956 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4126 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4226 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4250 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4339 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4145 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4645 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4433 N OVERHILL AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4604 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8109 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4107 N HARLEM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	U	O	O	NL	N	N/R	N			N	
4037 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8028 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8313 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8317 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4909 N EAST RIVER RD	N/A	N	N		2004	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4201 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4107 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4341 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4016 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8145 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	N		08/24/2022	N			N	
4023 N ODELL AVE	N/A	N	N			2004 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4028 N OLEANDER AVE	N/A	N	N			OMWATERMAINEPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8025 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5101 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4049 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4632 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4348 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4256 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4105 N OSCEOLA AVE	N/A	N	N			HISTORICALRE											

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8340 W FARRAGUT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4107 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4821 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4117 N OKETO AVE	N/A	N	N	2007	2007	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4318 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8100 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	U	L	L	N	01/01/2022	N				N	
7649 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4838 N PROSPECT AVE	N/A	N	N	2017	2017	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4102 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4124 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4300 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7100 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4440 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4316 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4209 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4919 N CLIFTON AVE	LP1A025	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7712 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4216 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4700 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4051 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4305 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4106 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8221 W GIDDINGS ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4132 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	IN/A	G	G	NL	Y	N/R	N			N	
4335 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		C	C	NL	N	N/R	N			N	
8256 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4214 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4121 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4114 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4851 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4225 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4135 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7951 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4847 N GREENWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4126 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4201 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4265 N HARLEM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4151 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4131 N ODELL AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4440 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4741 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5041 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4015 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4891 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4024 N OCTAVIA AVE	N/A	N	N	2006	2006	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4023 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4325 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4437 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4120 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4139 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8213 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4013 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8224 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4327 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4215 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4452 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4243 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4026 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5050 N CUMBERLAND AVE STE 25Z	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4813 N OZANAM AVE	N/A	N	N														

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4807 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8331 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4429 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4824 N GREENWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4140 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4301 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4313 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7752 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8542 W LAWRENCE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8005 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8122 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4138 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4214 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7924 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4256 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4234 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4417 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4312 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4848 N LEONARD DR	N/A	N	N	2020	2020	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4114 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7310 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4223 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4852 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4657 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4333 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4525 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4122 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4711 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4624 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4505 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4831 N GREENWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7312 W IRVING PARK RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8311 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5033 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7020 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	U	O	O	NL	N	N/R	N			N	
4304 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4219 N OTTAWA AVE	N/A	N	N	2007		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4030 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4319 N NEVA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4216 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7916 W ELM DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4221 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	L	L	N	06/30/2022	N			N	
8656 W AINSLIE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8017 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5050 N CUMBERLAND AVE STE 11L	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4856 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4645 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4416 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4625 N ORANGE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4336 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4701 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4920 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4105 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7013 W AGATIE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7931 W EXECUTIVE CT	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4761 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7334 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5050 N CUMBERLAND AVE STE 7G 8H 9I	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4210 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R</td					

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4724 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4135 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4013 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7012 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4257 N OSCEOLA AVE	N/A	N	N	2008	2008	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8644 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4645 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5009 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4100 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4520 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7060 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4714 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4253 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4100 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4345 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4617 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4104 N HARLEM AVE MMRR4	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/HISTORICALRECORDWATERSYSTEMRECORD	U	O	O	NL	N	N/R	N			N	
4231 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4609 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4109 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8200 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4231 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4204 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4151 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4321 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7420 W BERTEAU AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	In/A	G	G	NL	Y	N/R	N			N	
4432 N OZANAM AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4324 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4512 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4533 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4245 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4138 N OLcott AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7640 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4057 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4641 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4408 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4128 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4245 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4629 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4134 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4552 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4823 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7646 W IRVING PARK RD APT 1	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4017 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5165 N CANFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4219 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4216 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4524 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8640 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4314 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4018 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4332 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4106 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4259 N HARLEM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8336 W FARRAGUT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4412 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4035 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4237 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4628 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N						

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4014 N ODELL AVE	N/A	N	N	2008	2008 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4416 N REDWOOD DR	N/A	N	N		UNKNOWN		U	U	U	U	N		N			N	
4126 N OCTAVIA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4227 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4236 N NEWLAND AVE	N/A	N	N	2004	2004 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4106 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4143 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8209 W EASTWOOD AVE	N/A	N	N		UNKNOWN/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4300 N SAYRE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4336 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4114 N OLcott AVE	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4028 N OCTAVIA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4104 N HARLEM AVE MMCH	N/A	N	N		ESTIMATED/INVESTIGATIONVISUALINSPECTIONCUSTOMER		U	O	O	NL	N	N/R	N			N	
4024 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4843 N CUMBERLAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4127 N OLcott AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4605 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8248 W LAWRENCE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4308 N OTTAWA AVE	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4902 N GREENWOOD AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7917 W ELM DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4110 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7001 W SUNNYSIDE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4233 N SAYRE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8224 W LAWRENCE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4341 N NORDICA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4219 N HARLEM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		U	O	O	NL	N	N/R	N			N	
4104 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4829 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4219 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4935 N DELPHIA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4829 N PROSPECT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4136 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4345 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5111 N PITTSBURGH AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7709 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4240 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4528 N ORANGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4319 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4325 N NEVA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5135 N MONTEREY DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8130 W EASTWOOD AVE	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4044 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4613 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4344 N OKETO AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4018 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4424 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8612 W AINSLE ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4144 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4332 N OLEANDER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4801 N OPAL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4511 N THATCHER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8004 W GIDDINGS ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4947 N CHESTER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4036 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4107 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8322 W FARRAGUT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4255 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4156 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	</td

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
7911 W ELM DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4025 N OLEANDER AVE	LA1C062	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7952 W EXECUTIVE CT	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7778 W IRVING PARK RD	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7935 W EXECUTIVE CT	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7940 W EXECUTIVE CT	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7774 W IRVING PARK RD	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	U	O	C	NL	N	N/R	N			N	
7922 W ELM DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8292 W AINSLEY ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7951 W EXECUTIVE CT	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4412 N CANFIELD RD	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4935 N SUNRISE LN	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7936 W STRONG ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4845 N SUNRISE LN	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4900 N FRANK PKWY	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8300 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4215 N HARLEM AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
5134 N CUMBERLAND AVE	N/A	N	N			UNKNOWN	UNL	C	U	U	N	N				N	
8291 W STRONG ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7900 W STRONG ST	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8249 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8237 W AINSLEY ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8337 W LAWRENCE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
5200 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8310 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	G	NL	Y	N/R	N			N	
8236 W AINSLEY ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4926 N SUNRISE LN	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8422 W LAWRENCE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4832 N FRANK PKWY	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8270 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4215 N HARLEM AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
7402 W IRVING PARK RD	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
8212 W STRONG ST	N/A	N	N	2003		2003 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4744 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5134 N CUMBERLAND AVE	N/A	N	N			UNKNOWN	UNL	C	U	U	N	N				N	
4425 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8261 W AINSLEY ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7916 W LAWRENCE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5037 N EAST RIVER RD	N/A	N	N			UNKNOWN	UNL	C	U	U	N	N				N	
8300 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8330 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4601 N HARLEM AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
5134 N CUMBERLAND AVE	N/A	N	N			UNKNOWN	UNL	C	U	U	N	N				N	
4839 N SUNRISE LN	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4911 N SUNRISE LN	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8235 W STRONG ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7834 W LAWRENCE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7010 W FOREST PRESERVE DR	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4938 N LEONARD DR	N/A	N	N			UNKNOWN	UNL	C	U	U	N	N				N	
7953 W GUNNISON ST	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4401 N HARLEM AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7756 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8341 W CARMEN AVE	N/A	N	N	2007		2007 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8279 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8280 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8341 W WINNEMAC AVE	N/A	N	N	2002		2002 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8228 W STRONG ST	N/A	N	N	2003		2003 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8311 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N	N				N	
4801 N CANFIELD RD	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
8269 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4238 N SAYRE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N</td	

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8261 W STRONG ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8330 W CARMEN AVE	N/A	N	N	2005		2005 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8280 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8228 W AINSLE ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4113 N HARLEM AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4411 N CUMBERLAND AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT	U	O	O	NL	N	N/R	N			N	
4631 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7930 W STRONE ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8260 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N					N	
4918 N FRANK PKWY	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4311 N HARLEM AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4926 N FRANK PKWY	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7944 W STRONG ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8340 W WINNEMAC AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4851 N SUNRISE LN	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8250 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8259 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8331 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4833 N SUNRISE LN	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8276 W AINSLE ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N					N	
8281 W AINSLE ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4838 N SUNRISE LN	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4908 N FRANK PKWY	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8220 W STRONG ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4919 N CANFIELD RD	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4731 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4927 N FRANK PKWY	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7935 W GUNNISON ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8250 W CARMEN AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4939 N EAST RIVER RD	N/A	N	N			UNKNOWN	UNL	C	U	U	N					N	
7600B W IRVING PARK RD	N/A	N	N			UNKNOWN	U	O	U	U	N					N	
4330 N NEVA AVE	N/A	N	N			UNKNOWN	U	O	U	U	N					N	
4911 N CANFIELD RD	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8279 W CARMEN AVE	N/A	N	N	2003		2003 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8249 W WINNEMAC AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4951 N CANFIELD RD	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8260 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4409 N CUMBERLAND AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7300 W AGATTE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4829 N SUNRISE LN	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4918 N SUNRISE LN	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8321 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8269 W WINNEMAC AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8301 W CARMEN AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4474 N HARLEM AVE	N/A	N	N	2014		2014 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8205 W AINSLE ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4851 N FRANK PKWY	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4943 N FRANK PKWY	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4474 N HARLEM AVE	N/A	N	N	2014		2014 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4833 N FRANK PKWY	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4839 N CANFIELD RD	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4105 N HARLEM AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8276 W STRONG ST	N/A	N	N	2005		2005 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4942 N FRANK PKWY	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4828 N CUMBERLAND AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8284 W AINSLE ST	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8215 W STRONG ST	N/A	N	N	2006		2006 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4330 N HARLEM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4849 N EAST RIVER RD	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8270 W CARMEN AVE	N/A	N	N	2020		2020 OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7500 W MONROSE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		</td				

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8220 W AINSIE ST	N/A	N	N	2004	2004 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
8215 W AINSIE ST	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8284 W STRONG ST	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4340 N OLEANDER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4030 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4912 N OPAL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4875 N PONTIAC AVE	N/A	N	N	2005	2005 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4304 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5120 N ONEIDA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7827 W WINNEMAC AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4027 N OKETO AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8325 W MAPLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8233 W MAPLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4872 N CANFIELD RD	N/A	N	N	2005	2005 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4717 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4352 N SAYRE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4331 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4037 N OLEANDER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7764 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4413 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4404 N OPAL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4245 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5036 N PITTSBURGH AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7009 W AGATITE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4131 N OL'COTT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7331 W PENSACOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4042 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4132 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4500 N PONTIAC AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4600 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7057 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8240 W AGATITE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4317 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7231 W PENSACOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8145 W WINONA ST	N/A	N	N	2004	2004 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
8116 W WINONA ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
5177 N MORELAND DR	N/A	N	N	2007	2007 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4130 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7049 W SUNNYSIDE AVE	N/A	N	N		UNKNOWN		U	U	U	U	N	N	N			N	
4247 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4301 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4016 N OCTAVIA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4908 N ORANGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8016 W STRONG ST	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4030 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4057 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4804 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4928 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4813 N EAST RIVER RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4125 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4201 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7749 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4628 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4601 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4028 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4202 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4829 N LEONARD DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4305 N NOTTINGHAM AVE	N/A	N	N		CONTRACTOR EXCAVATION		UNL	C	C	NL	N	N/R	N			N	
8052 W WINNEMAC AVE	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C</									

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4437 N REDWOOD DR	N/A	N	N	2012	2012 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4246 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4701 N REDWOOD DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4035 N OVERHILL AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4315 N OVERHILL AVE	N/A	N	N		CONTRACTOR EXCAVATION		UNL	C	C	NL	N	N/R	N			N	
4045 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5135 N MISSION DR	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4608 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8245 W FOSTER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7808 W STRONG ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8673 W ARGYLE ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4115 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8333 W FARRAGUT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5112 N CANFIELD RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4671 N REDWOOD DR	N/A	N	N		UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
5102 N MORELAND DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4105 N OLcott AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4105 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4236 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4102 N OLEANDER AVE	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8112 W MAPLE AVE	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4007 N ODELL AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4249 N OLcott AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4246 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8260 W FOSTER AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4141 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7657 W STRONG ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4112 N ODELL AVE	N/A	N	N	2007	2007 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
7732 W STRONG ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4848 N GREENWOOD AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5021 N DENAL ST	N/A	N	N		CONTRACTOR EXCAVATION		UNL	C	C	NL	N	N/R	N			N	
4022 N OLEANDER AVE	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7218 W CULLOM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
5047 N CUMBERLAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5102 N MISSION DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5117 N CANFIELD RD	N/A	N	N	2016	2016 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4138 N OSCEOLA AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4420 N CANFIELD RD	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4254 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4504 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4132 N ODELL AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4624 N ORANGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4909 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4304 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8012 W EASTWOOD AVE	N/A	N	N	2013	2013 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
8112 W STRONG ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8307 W FOSTER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4321 W ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7502 W BELLE PLAINE AVE	N/A	N	N	2015	2015 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4329 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4114 N ODELL AVE	N/A	N	N	2007	2007 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4309 N OLEANDER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4040 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8241 W MAPLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5028 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4213 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8144 W COURTLAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		U	L	L	L	N	06/30/2022	N			N	
4325 N OLcott AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7340 W IRVING PARK RD	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
8373 W SUNNYSIDE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C</									

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
7006 W AGATITE AVE	N/A	N	N	2004	2004 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4147 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4751 N REDWOOD DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4156 N OLEANDER AVE	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
7319 W PENSACOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5032 N PITTSBURGH AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8600 W LAWRENCE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		U	O	O	NL	N	N/R	N			N	
7300 W CULLOM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4736 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
5005 N OVERHILL AVE	N/A	N	N	2008	2008 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
7916 W COURTLAND AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4246 N ORIOLE AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
8214 W EASTWOOD AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4916 N PONTIAC AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8109 W WINONA ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4103 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4201 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
8136 W LELAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5104 N ONEIDA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4901 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4215 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4317 N NORDICA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4117 N ODELL AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4912 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5181 N CANFIELD RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7216 W CULLOM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8123 W MAPLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		U	L	L	N		07/26/2022	N			N	
4107 N OKETO AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4825 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4433 N CANFIELD RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8353 W CORAL DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7708 W GIDDINGS ST	N/A	N	N	2022	INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4700 N OPAL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4121 N ODELL AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4048 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4850 N CRESCENT AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4557 N OSAGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4108 N OZARK AVE	N/A	N	N	2003	2003 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
5109 N CANFIELD RD	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
7211 W MONTROSE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4209 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4517 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4544 N OSAGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8321 W CORAL DR	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4841 N OPAL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4906 N PROSPECT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4833 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7923 W ELM DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7052 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4125 N OLCCOT AVE	N/A	N	N	2027	OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
5117 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5189 N CANFIELD RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4841 N LEONARD DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4312 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		U	L	L	L	N		01/01/2022	N		N	
4413 N OSAGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4854 N PONTIAC AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
8212 W MAPLE AVE	N/A	N	N		UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4021 N OLEANDER AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4925 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N				

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8216 W GUNNISON ST	N/A	N	N	2004	2004 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
7005 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4203 N OLEANDER AVE	N/A	N	N		CONTRACTOR EXCAVATION		UNL	C	C	NL	N					N	
4216 N OTTAWA AVE	N/A	N	N	2007	2007 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
7348 W CULLOM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4119 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4505 N PLAINFIELD AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4121 N OLEANDER AVE	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7010 W MONTROSE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4904 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5182 N MORELAND DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4636 N PLAINFIELD AVE	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4014 N OKETO AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4813 N CHESTER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4211 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5029 N KNIGHT AVE	N/A	N	N		CONTRACTOR EXCAVATION		UNL	C	C	NL	N	N/R	N			N	
8301 W WINONA ST	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
5180 N MONTEREY DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5118 N MORELAND DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5167 N MONTEREY DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7021 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5174 N MORELAND DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
5025 N KNIGHT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4736 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4210 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8101 W MAPLE AVE	LA1C083	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		U	L	L	N	07/17/2022	N				N	
4608 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4900 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8045 W WINONA ST	N/A	N	N	2008	2008 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
7030 W MONTROSE AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
8025 W GIDDINGS ST	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4912 N ORANGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4517 N THATCHER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		U	L	L	N	06/30/2022	N				N	
4340 N ORIOLE AVE	N/A	N	N		UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4629 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4110 N ODELL AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4224 N ODELL AVE	N/A	N	N	2005	2005 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
7342 W CULLOM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4148 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5161 N MORELAND DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7737 W WINDSOR AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4122 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8214 W GIDDINGS ST	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4037 N ODELL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4893 N REDWOOD DR	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN		UNL	C	U	U	N					N	
4645 N OPAL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8041 W CHARMAINE RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5021 N KNIGHT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4303 N OTTAWA AVE	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
8105 W LELAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4500 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4965 N PONTIAC AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8118 W EASTWOOD AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
8043 W LELAND AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4020 N OCTAVIA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8205 W LELAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5000 N ONEIDA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4556 N THATCHER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4252 N OSCEOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8032 W WINNEMAC AVE	N/A	N	N</td														

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8204 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4025 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7721 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	N	08/06/2022	N				N	
8372 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7760 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4112 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4916 N KNIGHT AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4112 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4501 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8218 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4041 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4656 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4924 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4102 N OVERHILL AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7705 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4237 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7104 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7343 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4137 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4308 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7112 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5045 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4050 N OCTAVIA AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4436 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4236 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4040 N OTTAWA AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4803 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8269 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4240 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4832 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4841 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4918 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4043 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
8356 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8125 W WINONA ST	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
7032 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7507 W BERTEAU AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4213 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5037 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8333 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5110 N MISSION DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7741 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7739 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	U	L	L	N	06/17/2022	N				N	
4218 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4649 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5036 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8040 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8110 W LAWRENCE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4104 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
4721 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5196 N MISSION DR	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4151 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4851 N GREENWOOD AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7748 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8044 W GIDDINGS ST	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4747 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4052 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5016 N DENAL ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7910 W ELM DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4641 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7928 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4047 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5009 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4505 N OAK ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	N	08/15/2022	N				N	
4328 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4332 N OKETO AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4054 N ORIOLE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4903 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8248 W WINONA ST	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4145 N ORIOLE AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4927 N PROSPECT AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4220 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4320 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4533 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4915 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4917 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7206 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4892 N PONTIAC AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8118 W COURTLAND AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4905 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4908 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4034 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4513 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8264 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4644 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8331 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7025 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4822 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8669 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7031 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5124 N MONTEREY DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4219 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4659 N OPAL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4343 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4424 N REDWOOD DR	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4421 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4813 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4816 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4121 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5105 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4322 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5141 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4943 N GREENWOOD AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4021 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7317 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8036 W EASTWOOD AVE	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4315 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
5132 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4310 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7818 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4911 N GREENWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4935 N PONTIAC AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4052 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5000 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5112 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8345 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4937 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8605 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4814 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N					

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4814 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4641 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4221 N OSCEOLA AVE	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
7923 W CORTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4053 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4935 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4101 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8304 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4653 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7028 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4931 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4042 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4213 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4629 N PLAINFIELD AVE	LA1A077	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4921 N EAST RIVER RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5017 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4425 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7121 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4015 N ZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4926 N PONTIAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5008 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7326 W CULOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4906 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4136 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4340 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7048 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5104 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5033 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4708 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8272 W WINONA ST	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4929 N ZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4832 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4616 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4328 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4200 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4015 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4830 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4153 N ZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4404 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4103 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4437 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4023 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4421 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4516 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4910 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4417 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4050 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4126 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7748 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4139 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4104 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4921 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4513 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5131 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8036 W WINNEMAC AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4012 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7009 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4309 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4901 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C									

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
7713 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4124 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4915 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7105 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4104 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4009 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7649 W NORRIDGE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4241 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7911 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4826 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4316 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4601 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4828 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4316 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8053 W CHARMIANE RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7625 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4524 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7246 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7803 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7020 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8146 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4133 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4301 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4401 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4800 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4720 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8205 W GIDDINGS ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4852 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4033 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4100 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4900 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4553 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7971 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4931 N GREENWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4900 N REDWOOD DR	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5129 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7247 W MONROSE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4248 N NEWLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4512 N PONTIAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4832 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4815 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4303 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8117 W MAPLE AVE	LA1C084	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	N		07/15/2022	N			N	
4524 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8355 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8337 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4008 N OKETO AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8237 W AGATITE AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8209 W MAPLE AVE	LP3S053	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4404 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7320 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4204 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4328 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7834 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4804 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4852 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4845 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4836 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7805 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4117 N OLcott AVE	N/A																

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4825 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4509 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8101 W EASTWOOD AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7720 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4636 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4825 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4233 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4560 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4709 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4228 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8320 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4125 N OSCEOLA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8255 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4708 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4337 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4128 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
5110 N MORELAND DR	N/A	N	N	2008		2008 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4235 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4123 N OKETO AVE	LP1A019	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7249 W MONROSE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8137 W WINONA ST	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7829 W CARMEN AVE	N/A	N	N	2016		2016 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4312 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7052 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7657 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4405 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4657 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4140 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4303 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5004 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7321 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4501 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4900 N CANFIELD RD	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7235 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4132 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4115 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5005 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4725 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8040 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4345 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4332 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4023 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4029 N OLEANDER AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4601 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4029 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4652 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8052 W GIDDINGS ST	N/A	N	N	2015		2015 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8305 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4428 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8229 W GIDDINGS ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8225 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4651 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4853 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4313 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4333 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4441 N REDWOOD DR	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4413 N REDWOOD DR	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4248 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4044 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4040 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL							

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4401 N REDWOOD DR	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
7003 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7655 W MONROSE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7727 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	U	L	L	L	N	01/01/2022	N			N	
7109 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4356 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7705 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	L	N	01/01/2022	N			N	
4752 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4226 N OLcott AVE	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4917 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8325 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8127 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8332 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4253 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4121 N ORIOLE AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4353 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5024 N PITTSBURGH AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4020 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4052 N ORIOLE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4833 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4401 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4322 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4102 N OKETO AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
8130 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4100 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5036 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7922 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7929 W ELM DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4256 N NOTTINGHAM AVE	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4816 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8205 W WILSON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	L	N	06/30/2022	N			N	
5033 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4201 N OKETO AVE	N/A	N	N	2008		2008 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
7645 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8128 W LAWRENCE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4872 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4156 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7720 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7802 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4139 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7331 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5156 N MONTEREY DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4300 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7704 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4660 N REDWOOD DR	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4813 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4920 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8119 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4661 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5159 N MONTEREY DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4212 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4030 N OVERHILL AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	01/01/2022	N			N	
4941 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4055 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4747 N CANFIELD RD	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
7208 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5100 N ONEIDA AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4111 N OLcott AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4536 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8215 W WILSON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8108 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4103 N ORIOLE AVE	N/A	N	N			OMWATERMAINEPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7832 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4016 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4138 N ODELL AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
7819 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4812 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5132 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4605 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4127 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4812 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7657 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4705 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4033 N ORIOLE AVE	N/A	N	N			OMWATERMAINEPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7100 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8131 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4961 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4224 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4900 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8312 W LELAND AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8260 W ARGYLE ST	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4420 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4241 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8144 W WINONA ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4218 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4945 N PONTIAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4513 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7308 W CULOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4112 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4500 N REDWOOD DR	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4208 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4717 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7044 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4620 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8129 W LELAND AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4827 N CRESCENT AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7015 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8044 W CHARMAINE RD	N/A	N	N	2003		2003 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8045 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4224 N OZARK AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4824 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4320 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4308 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7049 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4633 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8301 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4922 N GREENWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4836 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8300 W FARRAGUT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4552 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4840 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4212 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5021 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4500 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4915 N PONTIAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7329 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8352 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4819 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R					

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4131 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4220 N ODELL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4344 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4336 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4212 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4022 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4211 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4842 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7044 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7040 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4617 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4820 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4353 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4136 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4748 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8364 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8208 W GIDDINGS ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4109 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7228 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8032 W STRONG ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4110 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8332 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7617 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4600 N OZANAM AVE	LA3R068	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4416 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5008 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8316 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8036 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4057 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4428 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7836 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8036 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4304 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4812 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4245 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8048 W WINNEMAC AVE	N/A	N	N	2016	2016	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4924 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7928 W ELM DR	N/A	N	Y			CONTRACTOR EXCAVATION	UNL	C	L	L	N	N/R	N			N	
4652 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4127 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8025 W CHARMAINE RD	N/A	N	Y			CONTRACTOR EXCAVATION	U	L	L	L	N	N/R	N			N	
4955 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4027 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8236 W AGATTE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7024 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4158 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7304 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4457 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4918 N DELPHIA AVE	LP1A005	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4836 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4137 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4921 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8052 W WINONA ST	N/A	N	N	2006	2006	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4708 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4243 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4210 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8051 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4045 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4216 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONOR											

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4030 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4034 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7641 W NORRIDGE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4114 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7305 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8012 W COURTLAND AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4154 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
8044 W WINNEMAC AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4448 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4408 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5024 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4136 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7652 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4416 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4919 N DELPHIA AVE	N/A	N	N	2008		2008 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4429 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8204 W LAWRENCE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7001 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7309 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7713 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4941 N ORANGE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4743 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8029 W EASTWOOD AVE	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4842 N VINE AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4126 N OLICK AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4628 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7502 W BERTEAU AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4336 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8001 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4041 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
4829 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4846 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4863 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4825 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4102 N OSCEOLA AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4247 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4824 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7820 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4143 N OVERHILL AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7008 W AGATIE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4200 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N		N			N	
5141 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8636 W AINSLE ST	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4848 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7432 W BERTEAU AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4544 N ZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4103 N OVERHILL AVE	N/A	N	N		2015	2015 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4118 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4220 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8218 W GIDDINGS ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4013 N ODELL AVE	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4034 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8140 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5126 N MORELAND DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4811 N CRESCENT AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4621 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8604 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4020 N OSCEOLA AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4328 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5001 N																	

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4022 N OKETO AVE	N/A	N	N	2006	2006 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
5033 N RIDGEWOOD AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4210 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
7324 W PENSACOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8004 W LELAND AVE	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4808 N CRESCENT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8128 W WINONA ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4424 N CANFIELD RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8200 W MAPLE AVE	N/A	N	N	2007	2007 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4850 N VINE AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7741 W FOSTER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8028 W GIDDINGS ST	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4500 N OPAL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4123 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4808 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5040 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4111 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4127 N ORIOLE AVE	N/A	N	N		OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
8149 W WINNEMAC AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8296 W GUNNISON ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4819 N CRESCENT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7060 W SUNNYSIDE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7733 W ARGYLE ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8228 W AGATITE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4517 N REDWOOD DR	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
4505 N REDWOOD DR	N/A	N	N		UNKNOWN		U	U	U	U	N					N	
5185 N MORELAND DR	N/A	N	N	2007	2007 HISTORICALRECORDWATERSYSTEMRECORD		UNL	C	C	NL	N	N/R	N			N	
4429 N REDWOOD DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4241 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
4059 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4240 N NEWLAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4883 N CUMBERLAND AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8349 W CORAL DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4312 N ORIOLE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4952 N ORANGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4858 N CHESTER AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4343 N OTTAWA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
8791 W AINSLEY ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
5111 N MONTEREY DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4024 N OVERHILL AVE	N/A	N	N		UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
5004 N CANFIELD RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4121 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4842 N CANFIELD RD	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4805 N PROSPECT AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
7700 W GIDDINGS ST	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4853 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4248 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4821 N OZANAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5140 N MONTEREY DR	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4905 N ORANGE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4947 N GREENWOOD AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
5001 N OZARK AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7307 W PENSACOLA AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4313 N NOTTINGHAM AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4916 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER		UNL	C	C	NL	N	N/R	N			N	
4900 N KNIGHT AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
7741 W MONTROSE AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		U	L	L	L	N	08/24/2022	N			N	
4100 N OVERHILL AVE	N/A	N	N		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN		UNL	C	C	NL	N	N/R	N			N	
4044 N ORIOLE AVE	N/A	N	N		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL		UNL	C	C	NL	N	N/R	N			N	
5164 N MONTEREY DR</																	

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8321 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4621 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4604 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7303 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4053 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5042 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7212 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7242 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4316 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8040 W CHARMAINE RD	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4209 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5173 N CANFIELD RD	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4048 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4536 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7330 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4915 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5180 N MISSION DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4045 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4324 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4311 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4207 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4141 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8361 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
5006 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4206 N OVERHILL AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8001 W ELM DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4333 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4117 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7033 W AGATIE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4020 N ODELL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
5021 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7804 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8204 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4404 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4912 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4901 N CANFIELD RD	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8139 W CHARMAINE RD	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4057 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4216 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7705 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4749 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4225 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4342 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8064 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4513 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4608 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4628 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4227 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4924 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8037 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4251 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5105 N MISSION DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4207 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4317 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4945 N OZARK AVE	LP1A034	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5036 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7822 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5008 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4142 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N				

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4352 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8106 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7810 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4441 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4115 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4892 N CANFIELD RD	N/A	N	N	2021		2021 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
5143 N MONTEREY DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7004 W SUNNYSIDE AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8354 W FOSTER AVE	N/A	N	N	2018		2018 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4139 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8263 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8001 W GIDDINGS ST	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4337 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7931 W ARGYLE ST	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
5016 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4705 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4145 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4205 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4874 N PONTIAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7826 W ARGYLE ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7653 W NORRIDGE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5041 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4134 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4111 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4436 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4851 N EAST RIVER RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8023 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7648 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4112 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4333 N ORIOLE AVE	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4220 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4516 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7113 W AGATITE AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4035 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4848 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4209 N OTTAWA AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4200 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7929 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4222 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4931 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5016 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4133 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4044 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4141 N OTTAWA AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4115 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	G	G	NL	Y	N/R	N			N	
8229 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5119 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4835 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4026 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4857 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4145 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N					N	
4605 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4313 N OLEANDER AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7736 W SUNNYSIDE AVE	LA3R063	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4913 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4914 N GREENWOOD AVE	N/A	N	N	2008		2008 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
7841 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4822 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4108 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTION											

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4308 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4356 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4113 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4444 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4018 N ODELL AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8032 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4728 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8633 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8150 W LAWRENCE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5120 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5031 N DENALI ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4901 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4024 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8049 W WINNEMAC AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7751 W FOSTER AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4704 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5134 N CANFIELD RD	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4724 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7709 W ARGYLE ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8129 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5128 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4024 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4318 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7053 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7724 W WINONA ST	N/A	N	N	2013		2013 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4241 N OVERHILL AVE	N/A	N	N			UNKNOWN	UNL	C	U	U	N					N	
5125 N MISSION DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5137 N MORELAND DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4844 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4324 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4930 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8338 W ARGYLE ST	N/A	N	N	2002		2002 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4107 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4906 N PONTIAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5198 N MORELAND DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4428 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4445 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4333 N OSCEOLA AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4058 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4139 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4036 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4057 N OZARK AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4013 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8008 W STRONG ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4421 N PARIS AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4828 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7645 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4332 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4007 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7964 W EXECUTIVE CT	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
5185 N MISSION DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4813 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7712 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5113 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4236 N ORIOLE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4257 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8348 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4624 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7041 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4139 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R					

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
7851 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7338 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7729 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4139 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	U	L	L	N	08/26/2022	N				N	
4228 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4649 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4240 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8124 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4221 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4256 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4133 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5101 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4653 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5132 N MONTEREY DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7720 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4032 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N					N	
5134 N MISSION DR	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4529 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4021 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7229 W MONROSE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4307 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4240 N ORIOLE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7708 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5008 N DENAL ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4149 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4234 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4805 N GREENWOOD AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4817 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7841 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
5102 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7644 W NORRIDGE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4820 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4962 N PONTIAC AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4314 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4137 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4892 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4022 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5133 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4025 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N					N	
4133 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5112 N ONEIDA AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4813 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4137 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4157 N ORIOLE AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8113 W MAPLE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
5017 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5128 N CANFIELD RD	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4325 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4914 N DELPHIA AVE	LP1A004	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7941 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4212 N ODELL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
5028 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7230 W CULOM AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4916 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5157 N CANFIELD RD	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
7649 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4413 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8680 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8276 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8216 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCON											

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4241 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7637 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8245 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4605 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8040 W STRONG ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7209 W PENSACOLA AVE	N/A	N	N	2022		INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7061 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7017 W WINDSOR AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8660 W AINSLIE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5000 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4815 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4924 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4151 N OTTAWA AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4304 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5013 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4249 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4241 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4019 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4624 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8311 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4923 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4018 N OSCEOLA AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4924 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4126 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4813 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4130 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4239 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4928 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7100 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4908 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5041 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4421 N THATCHER AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4116 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4204 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4536 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7308 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4918 N GREENWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7847 W GUNNISON ST	N/A	N	N	2015		HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5113 N MORELAND DR	N/A	N	N	2015	2015 HISTORICALRECORDWATERSYSTEMRECORD	HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4873 N REDWOOD DR	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	U	U	N	N				N	
4905 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8022 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4244 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4017 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4834 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5005 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4940 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5101 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8216 W AGATTE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4853 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8284 W ARGYLE ST	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4050 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4440 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4007 N OSCEOLA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4300 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4144 N OTTAWA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
7717 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	L	N	07/25/2022	N			N	
7114 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4941 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N				

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4917 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4109 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4155 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7033 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4844 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7109 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4018 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8653 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4950 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4653 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4436 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7752 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4824 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4936 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4968 N PITTSBURGH AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7045 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4255 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4841 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4205 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4332 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4150 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4848 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8008 W LEANDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5195 N MONTEREY DR	N/A	N	N	2003		2003 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8344 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4513 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4412 N REDWOOD DR	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4204 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4135 N OKETO AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
4916 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4628 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7917 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7749 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7645 W MONTROSE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N				N	
5134 N MORELAND DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8349 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7000 W AGATIE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4816 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4244 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8057 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4800 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8616 W AINSLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8657 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8268 W AGATIE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4124 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7740 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7752 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8047 W LEANDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4108 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4058 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4805 N OPAL AVE	N/A	N	N	2011		2011 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
7753 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4400 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8124 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	U	L	L	L	N	01/01/2022	N			N	
4611 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4048 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4132 N OSCEOLA AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4931 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4919 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N				

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
8225 W GIDDINGS ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4252 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5136 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4609 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7744 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4900 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4901 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4320 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8006 W ELM DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7733 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	N	01/01/2022	N				N	
4027 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4629 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4515 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4613 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5120 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7001 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4807 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4240 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7003 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4894 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4893 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8237 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4928 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7120 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4532 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4014 N OSCEOLA AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
7110 W AGATITE AVE	N/A	N	N			2020 HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/LEGALDOCUMENT	UNL	C	C	NL	N	N/R	N			N	
7238 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4828 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8027 W EASTWOOD AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4828 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4040 N OVERHILL AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4935 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5029 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8134 W CHARMIANE RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5105 N ONEIDA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4008 N OSCEOLA AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4010 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4937 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4020 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4251 N ORIOLE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8032 W CHARMIANE RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4032 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4032 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4111 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4223 N SAYRE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5041 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7653 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8248 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7307 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4841 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7772 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4329 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4825 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7011 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7836 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4309 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4325 N OZANAM AVE	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4339 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	N							

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
5012 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7833 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7339 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
5108 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4873 N VINE AVE	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
7837 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7704 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4924 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8009 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4899 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4336 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4129 N OLCTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4047 N OZANAM AVE	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8300 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7318 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4909 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4935 N CANFIELD RD	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4898 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4521 N PLAINFIELD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7311 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8270 W MONROSE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
4108 N ODELL AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4333 N OLCTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4012 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4948 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4118 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
4116 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4735 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4037 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7348 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4741 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4915 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7214 W CULLOM AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4661 N REDWOOD DR	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
8344 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5053 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8004 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7729 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7309 W MONROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4850 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8337 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4108 N OLEANDER AVE	N/A	N	N			OMWATERMAINEPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N	N	N			N	
8356 W MAPLE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8116 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4867 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8145 W CHARMAINE RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4652 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4105 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7037 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4223 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4249 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7115 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5109 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4936 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4929 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7723 W MONROSE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
4240 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8035 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7334 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4224 N OTTAWA AVE	N/A	N	N</														

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4900 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4054 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4921 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4843 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7843 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5142 N MORELAND DR	N/A	N	N	2013		2013 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
5197 N CANFIELD RD	N/A	N	N	2007		2007 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8349 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4520 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4236 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4532 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4832 N CANFIELD RD	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8617 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7056 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8041 W WINNEMAC AVE	N/A	N	N	2012		2012 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4520 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7748 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4837 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4944 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4028 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4815 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4914 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4832 N CRESCENT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4898 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4828 N VINE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4308 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4946 N PONTIAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7828 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8121 W MAPLE AVE	L1C085	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	U	L	L	L	N	07/17/2022	N			N	
4902 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7326 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7822 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4919 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4100 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4412 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4808 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4923 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7814 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8133 W WINONA ST	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7323 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4353 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5005 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4729 N ORIOLE AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4625 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7327 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7105 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4211 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4048 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4633 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5040 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4817 N DELPHIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4828 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4541 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4133 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8123 W CHARMAINE RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4720 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4152 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4840 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4851 N CHESTER AVE																	

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4332 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4840 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7231 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4457 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4352 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4017 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7237 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4212 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7812 W WINNEMAC AVE	N/A	N	N	2008		2008 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4034 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4046 N OVERHILL AVE	N/A	N	N	2001		2001 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8256 W GUNNISON ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8621 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7761 W WILSON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8035 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4405 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4844 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8288 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4326 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4901 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4008 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4044 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4541 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4048 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4223 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8250 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7248 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4847 N EAST RIVER RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4206 N OZARK AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4132 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8308 W WINONA ST	N/A	N	N	2004		2004 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4050 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4053 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4704 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4925 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4841 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8136 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4012 N OSCEOLA AVE	N/A	N	N			UNKNOWN	U	U	U	U	N	N	N			N	
4126 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4917 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4218 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5190 N MORELAND DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4315 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4342 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5172 N MISSION DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8143 W WINNEMAC AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4945 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4349 N OLEANDER AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7728 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4118 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	U	L	L	N	06/15/2022	N				N	
4825 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4228 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8025 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4348 N ORIOLE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4841 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5121 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4453 N REDWOOD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4612 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4134 N OZARK AVE	N/A																

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4127 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4912 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8129 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	N	07/28/2022	N				N	
4019 N OLcott AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4115 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N					N	
4206 N ORIOLE AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8261 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7721 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8255 W WINONA ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7981 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4716 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7341 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7715 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	U	L	L	N	08/17/2022	N				N	
4820 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4352 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4357 N NOTTINGHAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8210 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4925 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5116 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4242 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4945 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4118 N OCTAVIA AVE	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7830 W CARMEN AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8007 W COURTLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7133 W SUNNYSIDE AVE	N/A	N	N	2005		2005 UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4326 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8345 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4909 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7101 W AGATITE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4724 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4123 N OZANAM AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4805 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4026 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4145 N OTTAWA AVE	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4240 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7222 W CULLOM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7604A W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	U	U	N					N	
4217 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4847 N PROSPECT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7103 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7653 W MONTROSE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
7606A W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	C	NL	N	N/R	N			N	
8016 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8344 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7313 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4243 N OVERHILL AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4006 N OKETO AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4540 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4805 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8026 W EASTWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4032 N ODELL AVE	N/A	N	N	2005		2005 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4841 N CLIFTON AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
8151 W LAWRENCE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7102 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8609 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4340 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5044 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4101 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4045 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4134 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C								

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
7008 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4325 N OLEANDER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7709 W WILSON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4121 N OKETO AVE	N/A	N	N			UNKNOWN/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4254 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8320 W LELAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4420 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4521 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4312 N NORDICA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5041 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4548 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7606B W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	C	NL	N	N/R	N			N	
4850 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4540 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8321 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4336 N OLEANDER AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4432 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4120 N OKETO AVE	N/A	N	N	2022		UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7717 W FOSTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5100 N CANFIELD RD	N/A	N	N	2004		2004 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8325 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4132 N OL'COTT AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4644 N THATCHER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4131 N OKETO AVE	LP1AD14	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8140 W CHARMAINE RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
5017 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4110 N OCTAVIA AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4325 N ORIOLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4300 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4011 N OL'COTT AVE	N/A	N	N	2018		2018 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
8215 W EASTWOOD AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4122 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8341 W WINONA ST	N/A	N	N	2016		2016 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4248 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7321 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4914 N CLIFTON AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4304 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7649 W GUNNISON ST	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7608B W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	C	NL	N	N/R	N			N	
8266 W GUNNISON ST	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4915 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4242 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4637 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4214 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	U	U	N					N	
4124 N OTTAWA AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4225 N O'DELL AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
8304 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8380 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4107 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4103 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4837 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4323 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7600A W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	U	U	N					N	
4039 N ORIOLE AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	L	L	N	07/28/2022	N			N	
4202 N OKETO AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4856 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4320 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4905 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4632 N OPAL AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R					


Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
4128 N OCTAVIA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4103 N OSCEOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8005 W GIDDINGS ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8276 W ARGYLE ST	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N					N	
8312 W CORAL DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
76028 W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	C	NL	N	N/R	N			N	
4308 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4653 N OPAL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8365 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4033 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
76108 W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	C	NL	N	N/R	N			N	
4921 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5149 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7221 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4204 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8357 W MAPLE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4256 N ODELL AVE	N/A	N	N			UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7761 W WINDSOR AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4230 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4875 N CUMBERLAND AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7311 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
5101 N CUMBERLAND AVE	N/A	N	N	2009		2009 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
7015 W AGATIE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4429 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7300 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4341 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4852 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4328 N OKETO AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4228 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4408 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7339 W MONTROSE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4019 N OZANAM AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8348 W FARRAGUT AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4845 N LEONARD DR	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4901 N CHESTER AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7826 W STRONG ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4713 N ORANGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7602A W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	C	NL	N	N/R	N			N	
4208 N OLEANDER AVE	N/A	N	N			OMWATERMAINREPAIRORREPLACEMENT/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4127 N OTTAWA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
7725 W ARGYLE ST	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
7210 W PENSACOLA AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4011 N OKETO AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4249 N ODELL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7712 W SUNNYSIDE AVE	N/A	N	N			CONTRACTOR EXCAVATION	UNL	C	C	NL	N	N/R	N			N	
4812 N RIDGEWOOD AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4113 N OL'COTT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4517 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
4857 N KNIGHT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8117 W COURTLAND AVE	N/A	N	N	2006		2006 HISTORICALRECORDWATERSYSTEMRECORD	UNL	C	C	NL	N	N/R	N			N	
4018 N OZARK AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8333 W SUNNYSIDE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8221 W MAPLE AVE	N/A	N	N			UNKNOWN	U	U	U	U	N					N	
4637 N OSAGE AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
7600C W IRVING PARK RD	N/A	N	N			UNKNOWN/ESTIMATED	UNL	C	U	U	N					N	
4023 N OVERHILL AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
4632 N OZARK AVE	N/A	N	N			INVESTIGATIONVISUALINSPECTIONPROFESSIONAL	UNL	C	C	NL	N	N/R	N			N	
4409 N CANFIELD RD	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER	UNL	C	C	NL	N	N/R	N			N	
8301 W FARRAGUT AVE	N/A	N	N			HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN	UNL	C	C	NL	N	N/R	N			N	
8257 W MAPLE AVE	N/A	N	N</														

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or IDPH notification, if customer refused access to property
5000 N RIDGEWOOD AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4017 N OTTAWA AVE	N/A	N	N	UNKNOWN			U	U	U	U	N		N			N	
4203 N OVERHILL AVE	N/A	N	N	UNKNOWN			U	U	U	U	N		N			N	
4125 N OZARK AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
4905 N CLIFTON AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4621 N THATCHER AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7740 W MONTROSE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7801 W MONTROSE AVE	N/A	N	N	UNKNOWN			U	U	U	U	N		N			N	
7748 W WINDSOR AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8620 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8660 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8652 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8648 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
8668 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
8636 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/INVESTIGATIONVISUALINSPECTIONCUSTOMER			UNL	C	C	NL	N	N/R	N			N	
8628 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8624 W CARMEN AVE	N/A	N	N	CONTRACTOR EXCAVATION			UNL	C	C	NL	N	N/R	N			N	
8672 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8684 W CARMEN AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8016 W CANFIELD RD	N/A	N	N	INVESTIGATIONVISUALINSPECTIONPROFESSIONAL			UNL	C	C	NL	N	N/R	N			N	
8211 W LELAND AVE	N/A	N	N	INVESTIGATIONVISUALINSPECTIONPROFESSIONAL			UNL	C	C	NL	N	N/R	N			N	
8580 W FOSTER AVE	N/A	N	N	OMWATERMAINEPAIRORREPLACEMENT/INVESTIGATIONVISUALINSPECTIONPROFESSIONAL			U	O	C	NL	N	N/R	N			N	
8552 W LAWRENCE AVE	N/A	N	N	UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8560 W LAWRENCE AVE	N/A	N	N	UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8564 W LAWRENCE AVE WS	N/A	N	N	UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
8254 W LAWRENCE AVE	N/A	N	N	INVESTIGATIONVISUALINSPECTIONPROFESSIONAL			UNL	C	C	NL	N	N/R	N			N	
8244 W AGATITE AVE	N/A	N	N	INVESTIGATIONVISUALINSPECTIONPROFESSIONAL			UNL	C	C	NL	N	N/R	N			N	
7123 W AGATITE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
7125 W AGATITE AVE	N/A	N	N	HISTORICALRECORDCONSTRUCTIONORPLUMBINGCODE/UNKNOWN			UNL	C	C	NL	N	N/R	N			N	
4104 N HARLEM AVE	N/A	N	N	ESTIMATED/INVESTIGATIONVISUALINSPECTIONCUSTOMER			U	O	O	NL	N	N/R	N			N	
7801 W MONTROSE AVE	N/A	N	N	ESTIMATED			U	U	U	U	N		N			N	
4104 N HARLEM AVE	N/A	N	N	ESTIMATED/INVESTIGATIONVISUALINSPECTIONCUSTOMER			U	O	O	NL	N	N/R	N			N	
4104 N HARLEM AVE	N/A	N	N	ESTIMATED/INVESTIGATIONVISUALINSPECTIONCUSTOMER			U	O	O	NL	N	N/R	N			N	
4104 N HARLEM AVE	N/A	N	N	ESTIMATED/INVESTIGATIONVISUALINSPECTIONCUSTOMER			U	O	O	NL	N	N/R	N			N	
4104 N HARLEM AVE	N/A	N	N	ESTIMATED/INVESTIGATIONVISUALINSPECTIONCUSTOMER			U	O	O	NL	N	N/R	N			N	

Appendix 3 Building Age Map




VILLAGE OF NORRIDGE LEAD SERVICE PROBABILITY

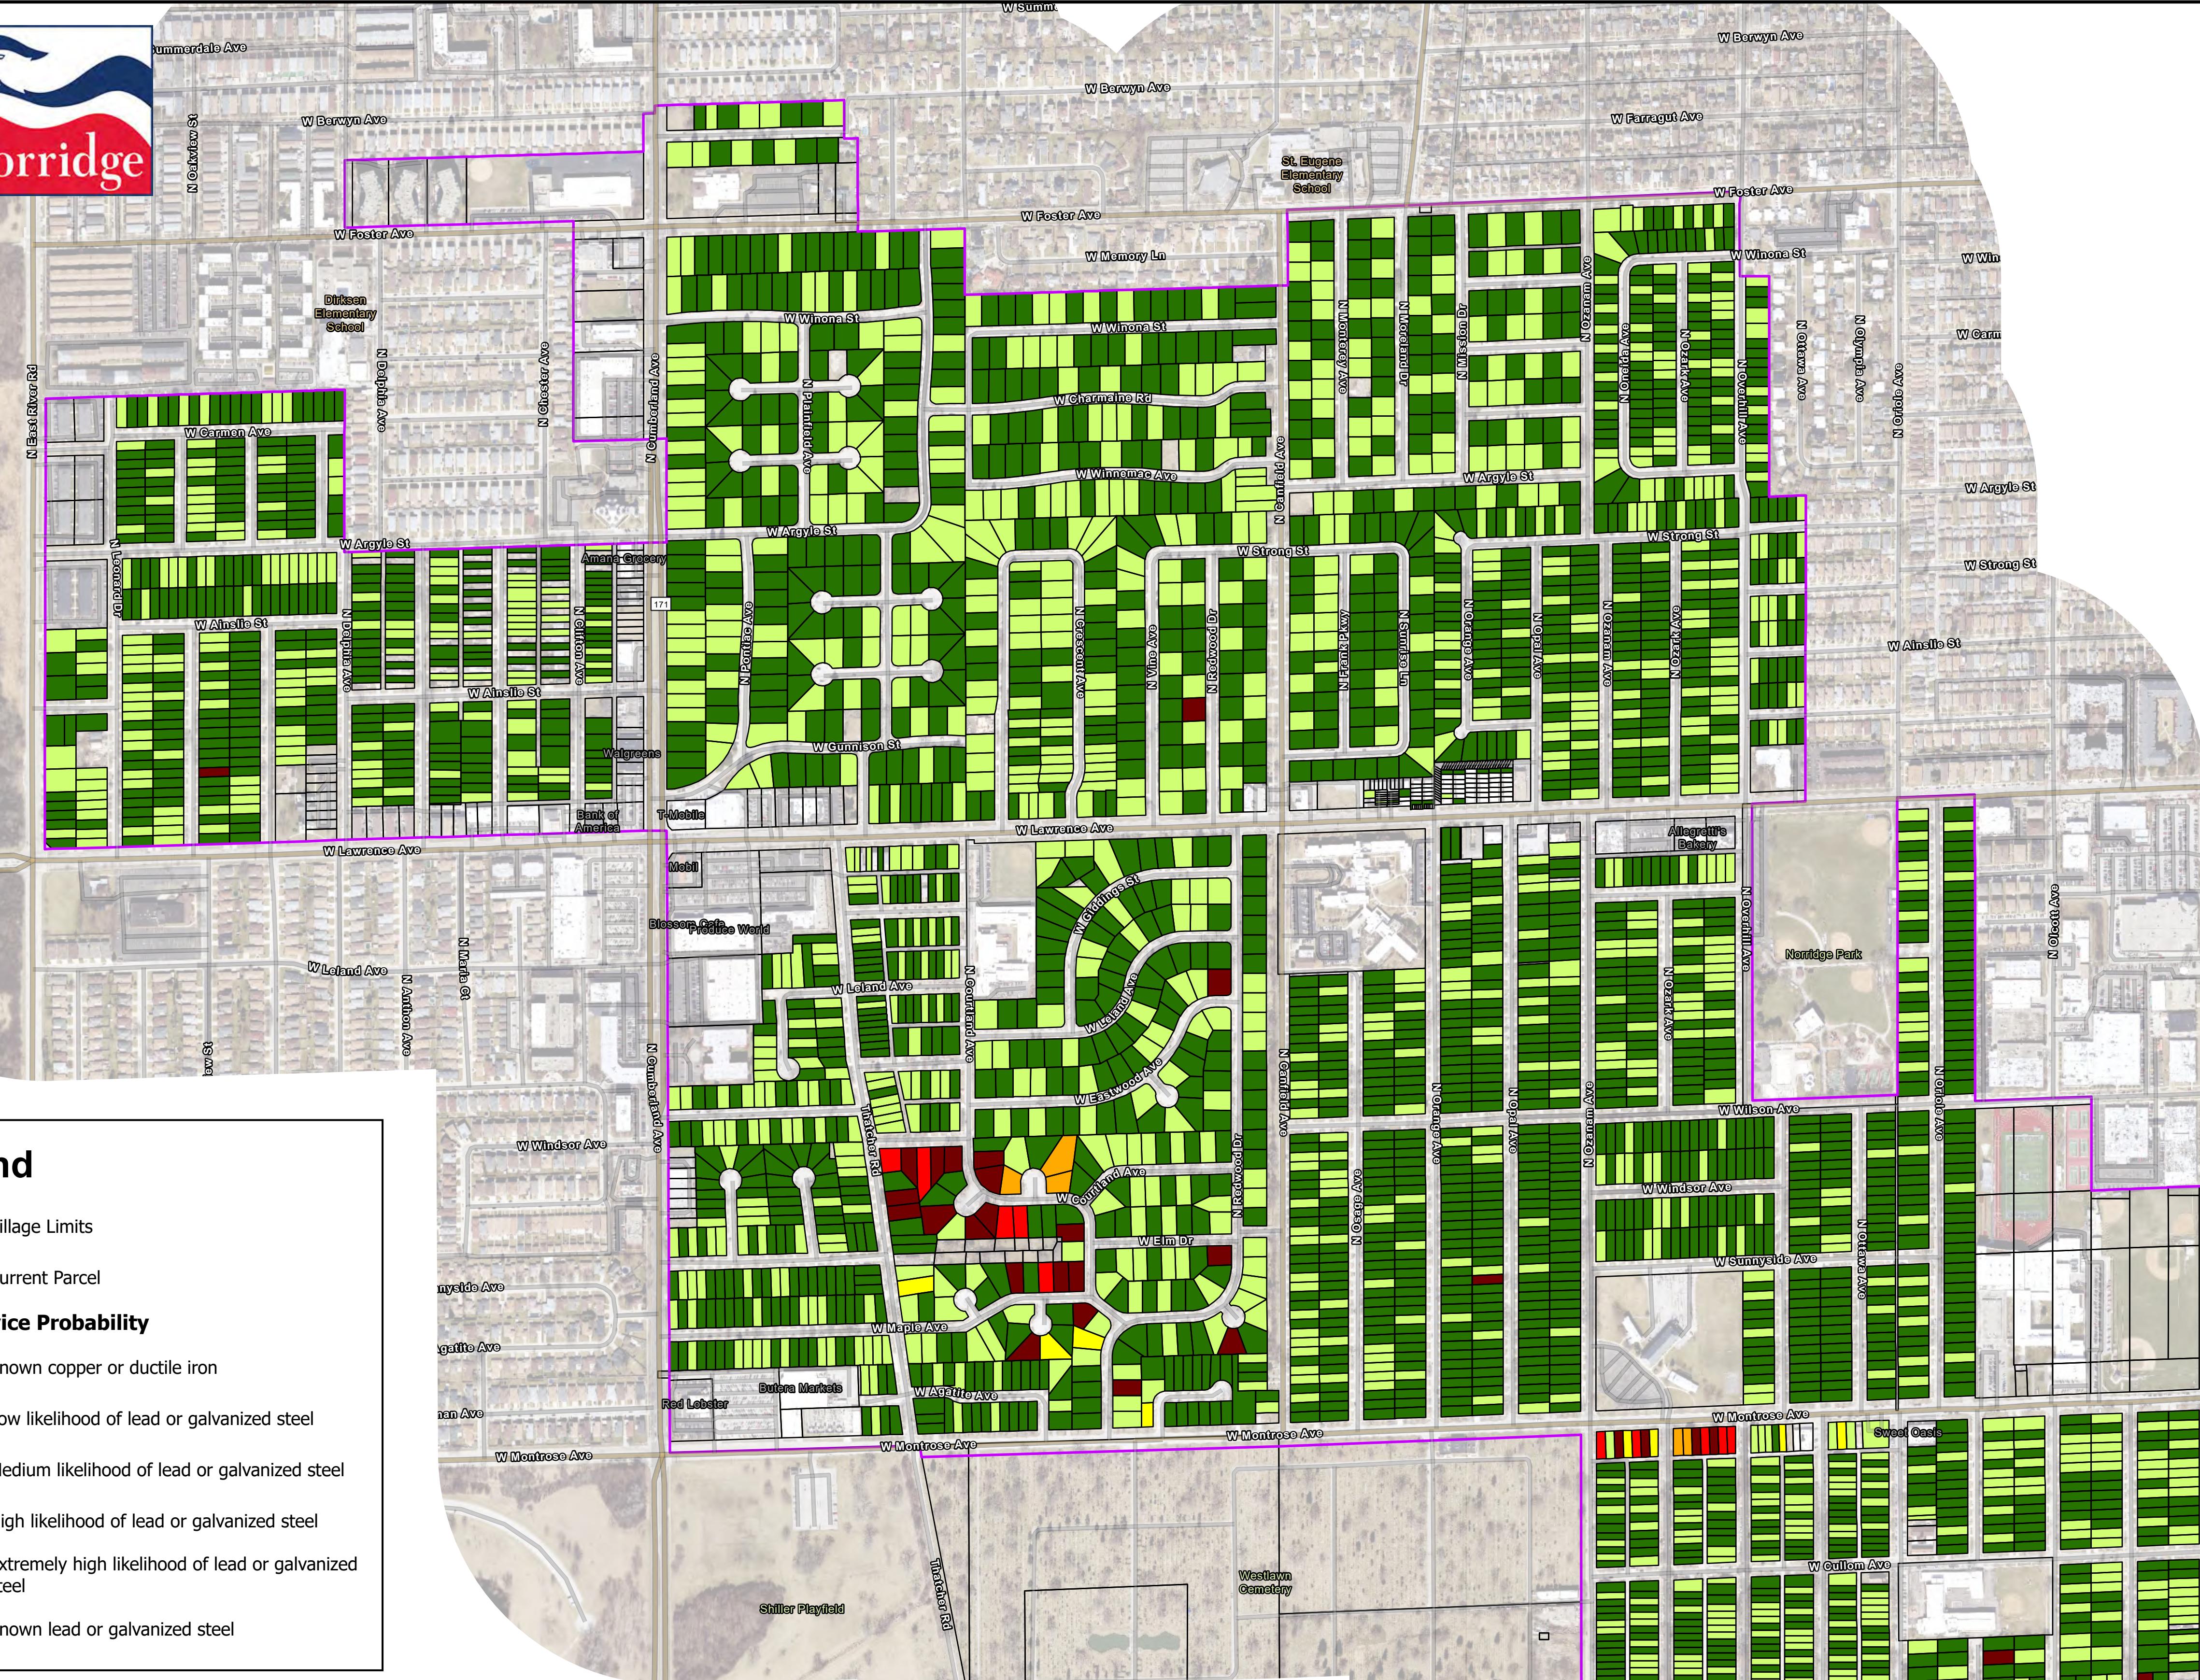


Legend

- Village Limits
- Current Parcel
- Lead Service Probability**
 - Known copper or ductile iron
 - Low likelihood of lead or galvanized steel
 - Medium likelihood of lead or galvanized steel
 - High likelihood of lead or galvanized steel
 - Extremely high likelihood of lead or galvanized steel
 - Known lead or galvanized steel

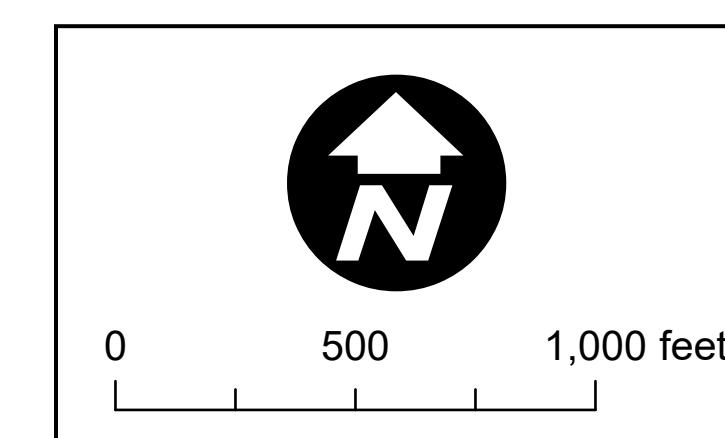

Date: 8/22/2022

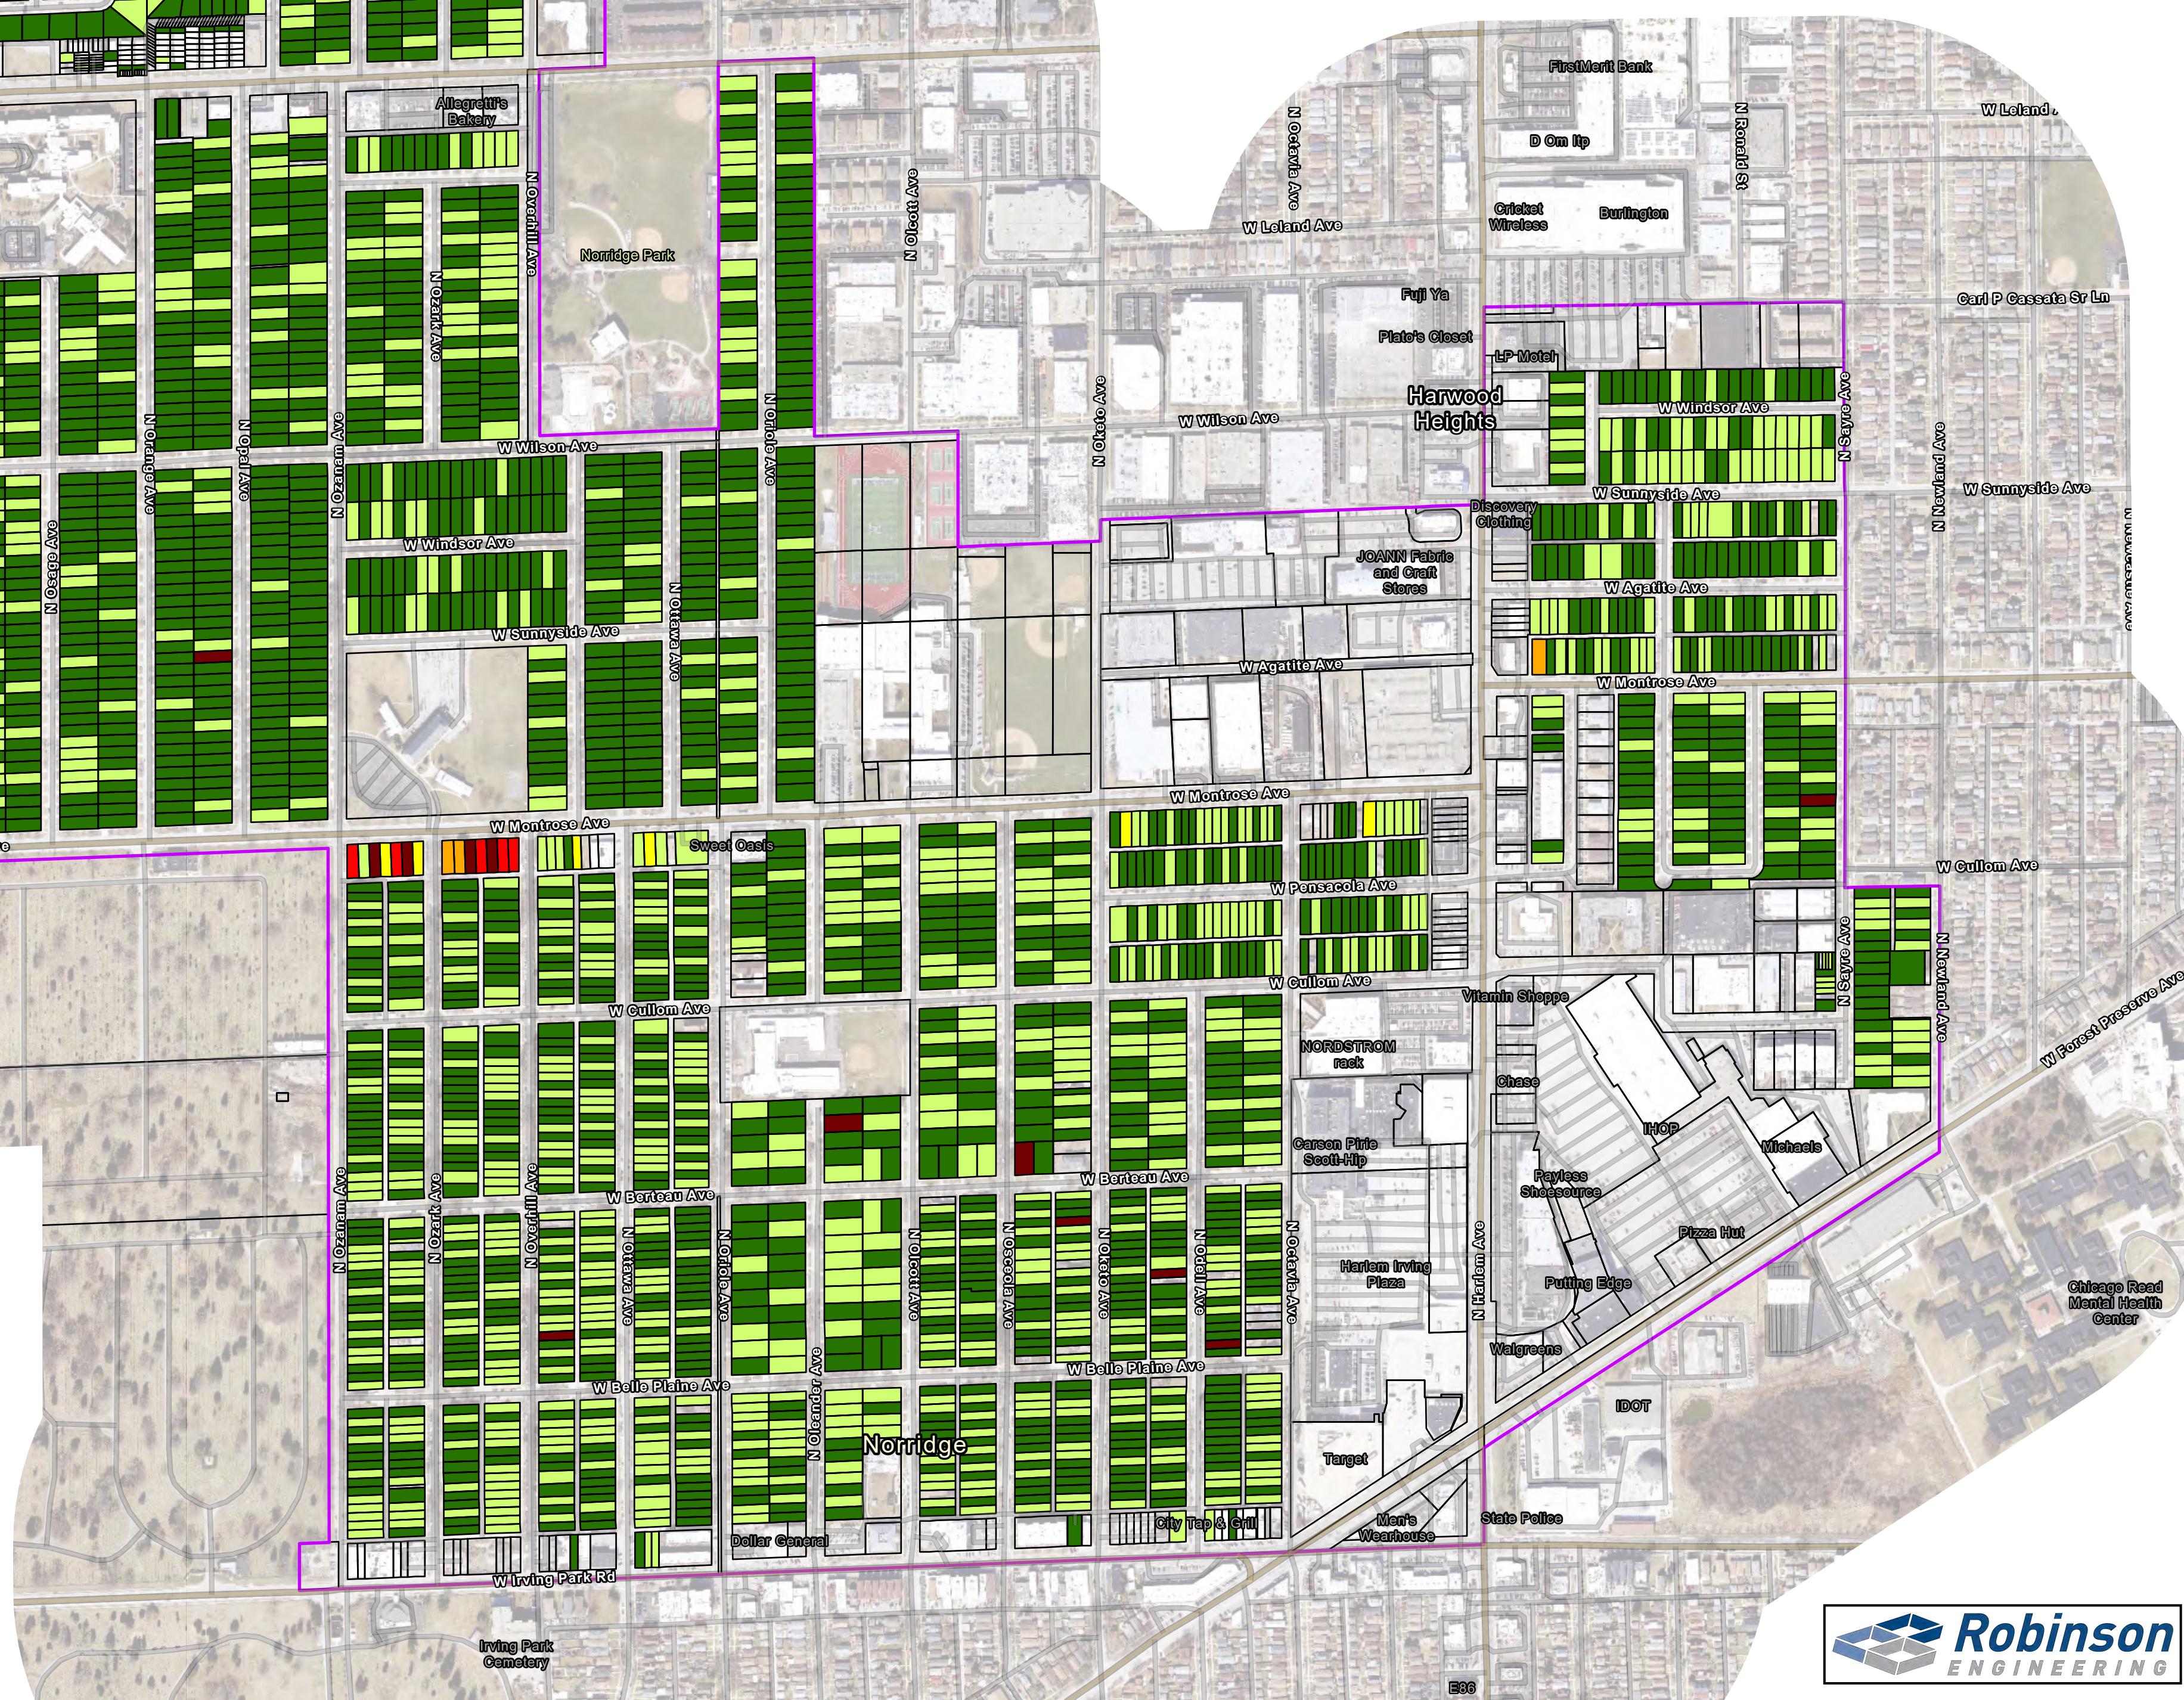

Appendix 4

Water Rates

ARTICLE IV. - WATER SYSTEM

DIVISION 1. - GENERALLY

Sec. 98-91. - Definitions.

The following words, terms and phrases, when used in this article, shall have the meanings ascribed to them in this section, except where the context clearly indicates a different meaning:

Curb valve means a shutoff valve attached to a water service pipe from a water main to a building installed near the curb, which may be operated by a valve key to start or stop flow in the water supply lines of a building.

Easement means an acquired legal right for the specific use of land owned by others.

Service box means a valve box used with corporation or curb valve.

Water meter or *meter* means the measuring device, wiring, transmission unit and all applicable appurtenances.

(Ord. No. 1328-01, § 1(5-2-1(A), 1-24-2001; Ord. No. 1620-08, § 2, 8-13-2008)

Cross reference— Definitions generally, § 1-2.

Sec. 98-92. - Right to shut off water supply.

The village reserves to itself, through its president and board of trustees, the right to shut off the water supply of any consumer at any time without preliminary notice, and all consumers of water shall be subject at all times to this reservation and right.

(Ord. No. 1328-01, § 1(5-6-8), 1-24-2001)

Sec. 98-93. - Violations.

For any violation of this article not otherwise provided for in this article, in addition to any penalty, the department shall not issue permits of any kind within its jurisdiction to the offending party until the party has complied with the provisions of this article.

(Ord. No. 1328-01, § 1(5-2-9), 1-24-2001)

Sec. 98-94. - Use of plumber's name.

No plumber shall allow his name to be used by any other person or party directly or indirectly for the purpose of obtaining permits or doing any work under his license.

(Ord. No. 1328-01, § 1(5-2-8), 1-24-2001)

Sec. 98-95. - Use of groundwater as potable water supply prohibited.

A. *Prohibition of use of groundwater as potable water supply.* The use or attempt to use groundwater as a

potable supply within the village is prohibited. The installation or drilling of any wells or use of any other means to extract groundwater within the village is hereby prohibited. Provided, however, any use which has been continuous and unabated since May 27, 1999, may continue without violating this section. Provided, further, any cessation or interruption of a use allowed by virtue of its existence on May 27, 1999, shall render any further use of groundwater as a supply of potable water to be prohibited under this section.

B. *Penalties.* Any person violating the provisions of this ordinance shall be subject to a fine of up to \$500.00 for each violation. Each day of violation shall constitute a separate offense.

C. *Definitions.* As used in this section, the following words shall have the definitions ascribed to them below:

Person is any individual, partnership, co-partnership, firm, company, limited liability company, corporation, association, joint stock company, trust, estate, political subdivision, or any other legal entity, or their legal representatives agents or assigns.

Potable water is any water used for human or domestic consumption, including, but not limited to, water used for drinking, bathing, swimming, washing dishes, or preparing foods.

(Ord. No. 1723-11, § 2, 11-9-2011)

Secs. 98-96—98-110. - Reserved.

DIVISION 2. - CONNECTIONS AND METERS

Sec. 98-111. - Application; connections.

- A. Any person or corporation desiring to make any connection with the water system or plant, or use water therefrom, shall first make application to the department. The application shall contain an agreement on the part of the applicant that all rules and regulations, conditions and provisions of any ordinance relating to the water and sewer system will be complied with; that all water rates, assessments and rents, and all fines and penalties assessed, charged or imposed against the applicant or the property described in the application will be paid. When the applicant has complied with all the provisions of the ordinances of the village, a permit shall then be issued by the superintendent authorizing the connection to be made and specifying the size thereof. All plumbing and plumbing work, also all excavating, filling and replacement of pavement, shall be done by a plumber authorized by the ordinances of the village to do such plumbing; provided, however, all such replacement of pavement shall be done by the contractor in accordance with the provisions of this Code or other applicable ordinances. The permit shall authorize any such plumber to do such plumbing and plumbing work as is described in the permit.
- B. No service pipe shall be laid or used to supply water to two or more distinct premises or buildings unless separate stop valves for each of the premises or buildings shall be placed outside of such premises in the parkway, as provided in this chapter, and a permit fee shall be obtained for each service.

(Ord. No. 1328-01, § 1(5-2-1(B)), 1-24-2001)

Sec. 98-112. - Water connections.

All connections to the water supply system maintained by the village shall be constructed in the manner as follows:

1. All water services commenced after February 1, 2001, must be metered.
2. Usage of potable water for flushing of sanitary sewers is prohibited.
3. Installation of water-saving plumbing fixtures shall include:
 - a. In all construction and in all repair or replacement of fixtures or trim, only fixtures and trim not exceeding the following flow rates of water usage shall be installed. These ratings shall be based on a pressure at the fixture of 40 to 50 pounds per square inch.

Water closets, tank type	3.5 gallons per flush
Water closets, flushometer type	3.0 gallons per flush
Urinals, tank type	3.0 gallons per flush
Urinals, flushometer	3.0 gallons per flush
Shower heads	3.0 gallons per minute
Lavatory, sink faucets	3.0 gallons per minute

- b. In addition to the requirements of subsection 3.a. of this section, in all new construction and replacement of fixtures, faucets of lavatories located in restrooms intended for public use shall be of metering or self-closing type.
- c. In all new construction and replacement of fixtures, car wash installations shall be equipped with a water recycling system.

(Ord. No. 1328-01, § 1(5-6-6), 1-24-2001)

Sec. 98-113. - Turning on water; seals.

- A. No person not duly authorized shall turn on any service valve, or use water therefrom.
- B. No seal placed by the department for the protection of any meter, valve, fitting or other water connection shall be defaced or broken except on written authority from the superintendent.
- C. No person or persons, other than members of the water department of the village, shall use water from any fire hydrant connected with the village water system, except for extinguishing fires or unless especially authorized by the superintendent.
- D. The penalty for the violation of this section 98-113 shall be a fine of \$1,000.00 for each offense, and the person so using or wasting water in such unlawful manner shall be liable to pay therefor at the regular water rates without discount.

(Ord. No. 1328-01, § 1(5-2-1(C)), 1-24-2001; Ord. No. 1512-05, § 2, 4-27-2005)

Sec. 98-114. - Meters.

- A. All water consumers supplied by the village shall be supplied through meters only, except that in cases where it is impracticable to set a meter, the use and consumption of water shall be governed by other applicable provisions of the ordinances of the village. Each individual commercial establishment, whether free-standing or part of a multi-unit retail center, must have its own meter.
- B. All meters used in connection with the water and sewer system shall be and remain for all time the property of the village and shall be purchased by the village, and the initial cost thereof shall be borne by the consumer.
- C. After the meter is placed, only officers or employees of the department shall be allowed to repair, remove or in any manner interfere with the meter. A valve shall be placed on each side of the meter.
- D. The cost of keeping each meter in repair shall be paid by the village. The person upon whose application any meter is installed shall be liable for any breakage or any loss or damage to such meter in any way, except by ordinary use and wear and the cost of making good such loss or damage shall be paid by the person upon whose application such meter was installed or repaired as soon as the bill for same is presented, and the amount therefor shall be a lien against the premises for which the meter was installed, to the extent and with the same effect as water rates. If a water meter shall have become worn out and unfit for use, the department shall install a new meter at village expense.
- E. The president and board of trustees shall in all cases determine the type and manufacturer of the water meters used in the village and no other kind shall be installed at any time.
- F. Water meters shall be located at such place and in such manner as the village through its board of trustees shall direct, and boxes or vaults in which such meters are to be placed shall be in accordance with specifications to be prescribed by the village, and such boxes or vaults must be so constructed as to prevent freezing of water flowing through such meters. Vaults must be kept in such condition so that the meter may be read at any time.

(Ord. No. 1328-01, § 1(5-2-1(D)), 1-24-2001; Ord. No. 1620-08, § 3, 8-13-2008)

Sec. 98-115. - Access to premises.

The superintendent and every person authorized by him and all meter inspectors shall have ready access to the premises, place or buildings where water meters are located for the purpose of reading, examining, testing, and repairing the same, and examining and testing the consumption, use and flow of water, and it shall be unlawful for any person or corporation to interfere with, prevent or obstruct the superintendent or such other person or inspector in his work under this section. Every consumer of water shall take the same upon the conditions prescribed in this chapter.

(Ord. No. 1328-01, § 1(5-2-1(E)), 1-24-2001)

Sec. 98-116. - Installation of meters; duties and responsibilities of customers.

- A. The connection from the main to the service valve shall be placed at least five feet below the level of the ground, and the pipe shall be laid sufficiently waving so that it shall be at least one foot longer than if laid in a

straight line and shall be placed in such manner as to prevent rupture or breakage from settling to the ground.

- B. Type K copper tubing must be used from the buffalo box to the meter providing permission therefor is obtained from the superintendent.
- C. No person, whether owner or occupant, in possession or control of any building, structure or premises into which water is supplied through the village water system shall be allowed, without permission from the president and board of trustees of the village, to supply other persons or families, or to supply water from such building or premises to any other building, structure or premises. Anyone who violates this provision may have his water service cut off until there shall have been paid to the village such sum of money as the president and board of trustees shall deem properly to be due the village.
- D. If, after the water supply shall have been turned on to any building, structure or premises, it shall be found by any officer or employee of the village that fraudulent representations have been made by an applicant for such water supply or that water is being used in or upon such building, structure or premises for purposes not set forth on the application made for such water supply, or that there is willful and unreasonable use or waste of water, the proper officer or employee of the village shall have the authority, and it shall be his duty, to cut off and stop the supply of water to such building, structure or premises forthwith, and the water shall not be turned on to such building, structure or premises until the person responsible for such fraudulent representation or for such use of water or willful or unreasonable waste thereof shall pay to the village such additional sum of money for such water supply or on account of such unreasonable waste of water as the president and board of trustees shall find properly to be due the village.
- E. Every person supplied with water from the village water system shall, at his own cost and expense, have installed and kept in repair all pipes leading from the buffalo or shutoff box to his building, structure or premises which are supplied with water through such service pipe. All service pipes laid from the water main to the buffalo or shutoff box and from the buffalo or shutoff box to the building, structure or premises shall not be less than one inch internal diameter.
- F. Each water service pipe shall be connected with the main water pipe and shall extend horizontally at right angles with the main water pipe to a point at least 18 feet from the centerline of the street and shall be provided with a brass stop valve of not less than one inch in diameter to be installed within telescopic shutoff box of the best quality of cast iron or first-grade steel pipe.
- G. All corporation and curb valves used in connection with the water system shall be approved by the superintendent. All casts shall be high grade, true to form and dimensions, smooth and free from all sand or blowholes or other foundry defects, and all material used therein shall be of the best quality and subject to the approval of the board of trustees of the village.
- H. Samples of corporation valves and stop valves must be submitted to the department for inspection before installation. The main must be tapped at an angle of 45 degrees from vertical, and the corporation valve must be turned so that the T handle will be on top.

(Ord. No. 1328-01, § 1(5-2-6), 1-24-2001)

Sec. 98-117. - Connection to standard main required.

In all cases where a standard water main is installed as of February 1, 2001, or may be installed after February 1, 2001, in any street or alley or other public way in the village, all water users located on any lot or parcel of real estate fronting or abutting on any such street or alley or other public way shall make or cause to be made connection to such standard water main and pay the tapping charges therefor within six months of February 1, 2001, or within six months after the installation of such standard water main if the same is not installed as of February 1, 2001, and such users shall discontinue within the same period of time any connection which they theretofore may have had with any temporary water line.

(Ord. No. 1328-01, § 1(5-2-6(A)), 1-24-2001)

Sec. 98-118. - Inspection and approval of service pipes.

All service pipes and connections shall be inspected and approved by the superintendent or other persons under his direction, and no such service pipes shall be covered until they have been so inspected; provided, however, that the provisions of this section shall not apply to work done under the jurisdiction of the board of local improvements.

(Ord. No. 1328-01, § 1(5-2-6(B)), 1-24-2001)

Sec. 98-119. - Water without meters.

Before a permit for the use of water shall be issued where meters cannot be conveniently used, the person applying for the same shall deposit the amount established in section 38-98 with the superintendent as payment on account of water to be used by him. On or before 30 days from the date of the permit, the person to whom such permit is issued shall file with the department a statement in writing, verified by his affidavit, showing fully the purpose for which the water was used by him for that time, and the amount and location of all work done by him during the time in connection with which any water was used or required. The superintendent shall ascertain from such statement and any other information the amount due for water used. If the amount so found to be due, together with all other fees and costs chargeable against such person, is less than the sum deposited, the surplus shall be paid back to the depositor. If the amount due for water so used is more than the sum deposited, then the excess shall be paid at once to the collector by such person. If such person desires to continue to use the water after he shall have filed his statement, he shall again deposit the amount established in section 38-98 with the superintendent and shall continue to make deposits thereafter and in the same manner as provided in this section with respect to the first deposit and the method of determining the amount of water used and the charge for such water shall be the same as the provisions respecting the first deposit as provided in this section.

(Ord. No. 1328-01, § 1(5-2-7), 1-24-2001)

Secs. 98-120—98-140. - Reserved.

DIVISION 3. - RATES, CHARGES AND FEES

Sec. 98-141. - Rates.

- A. *Established.* There shall be and are hereby established rates and charges for the use of water supplied by the water department of the village, as shown by the water meters, as set forth in section 38-98.
- B. *Within the corporate limits of the village.* The rates and charges for service shall be payable bi-monthly. The owner of the premises, the occupant thereof, and the user of the service shall be jointly and severally liable to pay for the service on such premises, and the service is furnished to the premises by the village only upon the condition that the owner of the premises, occupant, and user of the service are jointly and severally liable therefor to the village.
- C. *Construction.* The charge for water during the period of construction shall be paid before construction on any building is started.
- D. *Other rates and methods of measurement.* The water used for rates and methods of measurement which are not specifically provided for by ordinance shall be estimated by the superintendent of the water department or by such officer as may be designated by the president and board of trustees to perform the duties of such superintendent and assessed at the rate established in section 38-98. Whenever practicable, however, a meter shall be used as the basis of such estimate.
- E. *Outside of corporate limits.* Water provided out of the corporate limits shall be provided at twice the rate of water provided within the village.
- F. *Annual review of rates.* The adequacy of the water service charge shall be reviewed, not less often than annually, by certified public accountants for the village in their annual audit report. The water service charge shall be revised by the village board periodically to reflect a change in local capital costs or operations, maintenance and replacement costs.
- G. *Rate/charge appeals.* The adequacy of the rates and the computation of service charges established for water user charges shall be made available to any user within 14 days of a written request for such. Any disagreement over the method used or in the computations thereof shall be remedied by the authority within 14 days after a notification of a formal written appeal outlining the discrepancies.

(Ord. No. 1328-01, § 1(5-2-2(A)), 1-24-2001; Ord. No. 1381-02, § 1, 1-23-2002; Ord. No. 1773-13, § 2, 5-22-2013)

Sec. 98-142. - Escrow deposits.

All commercial/industrial water users shall deposit the minimum sum established in section 38-98 with the village as security for the payment of water charges. Such deposits shall be made prior to the issuance of a business license. During the operation of the business, the escrow deposit shall be reassessed to the amount equal to the bi-monthly average usage or \$200.00, whichever is greater, and, if necessary, an additional escrow amount shall be charged. The escrow shall be returned, upon written request, at the time the premises are vacated and final water bill paid by the depositor. If no written notice of intention to vacate or sell is given by the depositor, the total escrow deposit shall be forfeited.

(Ord. No. 1328-01, § 1(5-2-2(B)), 1-24-2001; Ord. No. 1773-13, § 2, 5-22-2013; Ord. No. 2027-21, § 2, 4-28-2021)

Sec. 98-143. - Prohibition on purchase of water.

No person, having his residence or place of business within the territorial limits of the village shall be permitted to buy water or secure sewerage facilities from any other municipal corporation or other public utility for such residence or place of business located in the village whenever the water or sewer or both of the waterworks and sewerage system of the village are adjacent to their property.

(Ord. No. 1328-01, § 1(5-2-2(C)), 1-24-2001)

Sec. 98-144. - Payment of charges, delinquent accounts.

- A. *When due.* All water charges shall be due and payable on or before the stated due date on the bill. Late charges of ten percent of the bill shall be assessed on the day following the stated due date on the bill.
- B. *Statements.* Statements for water charges shall be delivered to customers as follows:
 1. *Residential customers.* Residential customers shall be billed on a bi-monthly basis.
 2. *Schools, parks and governmental customers.* Schools, parks and governmental customers shall be billed on a bi-monthly basis.
 3. *Commercial/industrial customers.* Commercial and industrial customers shall be billed on a bi-monthly basis.
- C. *Lien; shutoff of delinquent accounts.* Whenever any such charges shall remain unpaid for a period of more than 30 days from the date of the statement provided for in this section, the village treasurer shall file with the county recorder of deeds a statement of lien claim and the water shall be turned off from the premises of such delinquent consumer and the service shall not be resumed until all water bills in arrears and penalties have been paid, including a charge as established in section 38-98 for the services of the water department in turning off and on the water. The statement of the lien claim shall contain the legal description of the premises served, the amount of the unpaid bill, and a notice that the village claims a lien in the amount as well as for all charges subsequent to the period covered by the bill. The failure of the village treasurer to record such lien shall not affect the right to foreclose the lien for unpaid bills.
 1. *Notice to owner.* If the user whose bill is unpaid is not the owner of the premises and the village treasurer has notice of this fact, notice shall be mailed to the owner of the premises if his address is known to the treasurer, whenever such bill remains unpaid for the period of 105 days for a bill after it is rendered. The failure of the village treasurer to mail such notice or of the owner to receive such notice shall not affect the right to foreclose the lien for unpaid bills as mentioned in the foregoing section.
 2. *Foreclosure of lien.* Property subject to a lien for unpaid charges shall be sold for nonpayment of the same, and the proceeds of the sale shall be applied to pay any charges, after deducting costs, as is the case in the foreclosure of statutory liens. Such foreclosure shall be by bill-in-equity in the name of the village. The village attorney is hereby authorized and directed to institute such proceedings in the name of the village in any court having jurisdiction over such matters against any property for which the bill has remained unpaid 105 days after a bill has been rendered.
 3. *Temporary shutoff.* When the water is shut off temporarily at the request of any consumer and the meter is not removed, the consumer shall pay the regular minimum rate per month.
 4. *Reconnection.* No person owing water charges and moving to other premises where there are water connections, or where connections shall afterward be made, shall be supplied with water until such

charges in arrears are paid in full.

(Ord. No. 1328-01, § 1(5-2-3), 1-24-2001; Ord. No. 1563-07, § 2, 2-28-2007; Ord. No. 1773-13, § 2, 5-22-2013)

Sec. 98-145. - Responsibility for water registered by meter.

- A. The owner and tenant of premises supplied with water will be held jointly and severally responsible for all water registered by the meter and no reduction shall be made or rebate allowed to any consumer on account of leakage or alleged leakage in any pipe, tank or other apparatus or device.
- B. Any person or party who shall vacate any premises, or any party who shall enter upon and occupy any premises, shall immediately, before vacating the premises or moving to premises, notify the water department and secure a reading of the meter.

(Ord. No. 1328-01, § 1(5-2-4), 1-24-2001)

Sec. 98-146. - Fees.

A. *Connection fees.*

1. The fees to be charged for a permit to tap or otherwise make a connection to any water main shall be as established in section 38-98.
2. The owner is responsible for the cost of all materials for a new water service. Meters supplied to all residential and commercial establishments must be paid for by the owner at the then-current cost of such meters. All new water service materials and meters shall remain for all time the property of the village.
3. In any case where the lateral water main to which the connection is to be made has been constructed by the person desiring such connection or where the costs of construction of such lateral water main to which the connection is to be made have been paid for in whole or in part by the person desiring such connection, the charge for such tapping permit shall be reduced to such amount as may have been agreed upon between such person and the board of trustees of the village at the time of the construction and installation of such lateral water main.

B. *Tapping water mains; cost.*

1. Whenever any permit for a connection with the water mains of the village is issued under this chapter, the contractor shall be responsible to make the tap as designated by and approved by the superintendent or an employee of the village so designated for the work by the superintendent.
2. No connection with any water main of the village installed after February 1, 2001, shall be less than one inch.
3. No person shall in any manner obstruct or cause to be obstructed the free access of any duly authorized officer or employee of the village, to any stop valve, water meter, elevator dial, buffalo or shutoff box or connection with any water main or service pipe.

(Ord. No. 1328-01, § 1(5-2-5), 1-24-2001; Ord. No. 1684-10, § 2, 8-11-2010)

Secs. 98-147—98-160. - Reserved.

DIVISION 4. - WATER CONSERVATION

Sec. 98-161. - Violation of conservation measures.

It shall be unlawful for any person to violate any provisions of this division, including the outdoor water use regulations established in this division or the provisions of any emergency water conservation regulations established pursuant to this division.

(Ord. No. 1328-01, § 1(5-3-3), 1-24-2001)

Sec. 98-162. - Lawn sprinkling and other outdoor water use.

- A. Due to the increased demand for water for lawns, gardens and swimming pools during summer months from May to September and to prevent water shortages that may endanger the health, safety and welfare of the residents of the village, there is hereby established a water usage schedule for the purpose of regulating the outdoor use of water. For purposes of this article, the terms "outdoor water use" and "outdoor use of water" mean the use of water from the village's municipal potable water system for watering of a lawn, garden or shrubbery and swimming pool filling employing the use of a hose, pipe, duct, sprinkler or sprinkling system but shall not include the use of rainwater or recycled water for any of the above named purposes.
- B. Between 12:00 p.m. on May 15 and 6:00 p.m. on September 15, no outdoor uses of water will be permitted between the hours of 12:00 p.m. and 6:00 p.m.

(Ord. No. 1328-01, § 1(5-3-1), 1-24-2001)

Sec. 98-163. - Emergency water shortage.

- A. When either the president of the village or the director of public works determines that a water shortage exists in the village as a result of the overall demand upon the village water supply system being too great or due to the malfunction or breakdown of the pumps or any other portion of the water system and that the condition is such as to endanger the public health, safety and welfare of the residents of the village, that person may declare a water supply emergency. If it is the director, he must notify the village president and/or trustees in writing that a water supply emergency exists.
- B. It shall be the duty of the president or, in his absence, the trustees to issue an executive order setting forth such emergency water conservation regulations as are appropriate to alleviate such emergency conditions.
- C. The president is empowered to issue emergency water conservation regulations limiting or prohibiting the drawing or use of water from the village water supply line and system or to limit, suspend or prohibit the use of such water during the emergency period for use in sprinkling or irrigations of lawns, gardens, shrubbery or trees, for use in car washing or private swimming pools, or air conditioning or cooling, or for commercial or industrial uses beyond requirements for sanitation or preserving health, or any other use that is not directly connected with the preservation of health, sanitation, safety or the public welfare.

(Ord. No. 1328-01, § 1(5-3-2), 1-24-2001)

ORDINANCE NO. 2069-22

AN ORDINANCE AMENDING CHAPTER 38 OF
THE REVISED MUNICIPAL CODE OF THE VILLAGE OF NORRIDGE - 2002

An Ordinance Implementing a Pass-Through of the
City of Chicago June 1, 2022 Water Rate Increase

DANIEL TANNHAUSER, PRESIDENT

DONALD GELSONIMO, TRUSTEE
JACK BIELAK, TRUSTEE
DEBRA J. BUDNIK, TRUSTEE

BILL LARSON, TRUSTEE
ANDREW RONSTADT, TRUSTEE
FRANK AVINO, JR., TRUSTEE

GABRIELA KRASINSKI, VILLAGE CLERK

ORDINANCE NO.2069-22

AN ORDINANCE AMENDING CHAPTER 38 OF
THE REVISED MUNICIPAL CODE OF THE VILLAGE OF NORRIDGE - 2002

An Ordinance Implementing a Pass-Through of the
City of Chicago June 1, 2022 Water Rate Increase

WHEREAS, the Village of Norridge ("Village"), as a home rule municipality in accordance with Article VII Section 6(a) of the Constitution of the State of Illinois of 1970, has enacted various ordinances providing for the protection of the health, safety, and general welfare of the Village; and

WHEREAS, this Ordinance is being adopted pursuant to the Village's home rule authority; and

WHEREAS, the Village supplies water to its residents and businesses who pay the Village for the water provided; and

WHEREAS, effective June 1, 2022, the City of Chicago will increase the rates charged to the Village for water, which increased cost must be recovered by the Village; and

WHEREAS, the Village's cost to maintain the infrastructure, to deliver the water to its residents and businesses is increasing faster than the revenues received by the Village; and

WHEREAS, this Ordinance enacts as a pass-through expense the City of Chicago's new increased rate it charges the Village for supplying water to the Village.

NOW, THEREFORE, BE IT ORDAINED by the President and Board of Trustees of the Village of Norridge, Cook County, Illinois as follows:

Section 1.

The facts and statements contained in the preamble to this Ordinance are found to be true and correct and are hereby adopted as part of this Ordinance.

Section 2.

That Chapter 38, Section 38-98 subsection 98-141 of the Revised Municipal Code of the Village of Norridge - 2002 be and hereafter is amended to read as follows:

Chapter 38 - FINES, PENALTIES AND FEES

Sec. 38-98. - Utilities.

98-141 Water rates.

(a) Residential rates--Per residential unit:

Minimum bi-monthly charge (up to but not exceeding 6,000 gallons) . . . \$36.12

Plus bi-monthly Infrastructure Maintenance Fee. \$40.00

Plus for each gallon exceeding the minimum 6,000 gallon charge . . . \$0.00602

(b) Schools/parks/governmental buildings:

Minimum bi-monthly charge (up to but not exceeding 6,000 gallons) . . . \$36.12

Plus bi-monthly Infrastructure Maintenance Fee. \$40.00

Plus for each gallon exceeding the minimum 6,000 gallon charge . . . \$0.00602

(c) Commercial/industrial rates--Per unit:

Minimum monthly charge (up to but not exceeding 6,000 gallons) . . . \$46.62

Plus monthly Infrastructure Maintenance Fee. \$20.00

Plus for each gallon exceeding the minimum 6,000 gallon charge . . . \$0.00777

(d) Construction--Non-metered:

Residential, per year \$456.72

Schools/parks/government buildings \$0.00

Churches. \$0.00

Commercial/industrial, per year \$799.44

Section 3.

The increased rates shall be effective June 1, 2022.

Section 4.

All ordinances or parts of ordinances in conflict herewith are hereby repealed.

Section 5.

This Ordinance shall be in full force and effect from and after its passage, approval and publication in pamphlet form as provided by law.

Section 6.

If any provision of this Ordinance, or the application of any provision of this Ordinance, is held unconstitutional or otherwise invalid by a court of competent jurisdiction, such provision shall be stricken and shall not affect any other provision of this ordinance.

[This space intentionally left blank.]

PASSED by the President and Board of Trustees of the Village of Norridge, Cook County, Illinois, this 27th day of April 2022.

AYES: 6

NAYS: 0

ABSENT: 0




Gabriela Krasinski
Village Clerk

APPROVED this 27th day of April 2022.



Honorable Daniel Tannhauser
Village President

PUBLISHED by me this 27th
day of April 2022 in
pamphlet form.



Gabriela Krasinski
Village Clerk

Water Rate Information And Fees

- Each residential customer is billed once every two months.
- Each commercial customer is billed every month.
- The monthly infrastructure fee is based on the number of unit(s) at the location.
- The Water Department is available at 708-453-0319  for rate and billing information.

Residential/School/Park/Church Property effective June 1, 2022

Minimum Bi-Monthly Billing - \$36.12 for up to but not exceeding 6,000 gallons.

\$0.00602 for each gallon over the minimum.

\$40.00 Bi-Monthly Infrastructure Maintenance Fee (per unit)

Commercial/Industrial Property– effective June 1, 2022

Minimum Monthly Billing - \$46.62 for up to but not exceeding 6,000 gallons.

\$0.00777 for each gallon over the minimum.

\$20.00 Monthly Infrastructure Maintenance Fee (per unit)

Construction – Non-metered

Residential Property - \$456.72

Commercial Property - \$799.44

Fees

Residential Property –Turn water off or on - \$50.00

Commercial Property –Turn water off or on - \$100.00

Fines


Unauthorized turn on of any service or use water therefrom - \$1,000.00

Broken or removed meter seal - \$1,000.00

Unauthorized use of fire hydrants - \$1,000.00


Damaged meter equipment – Cost of replacement

Appendix 5 LSLR Details

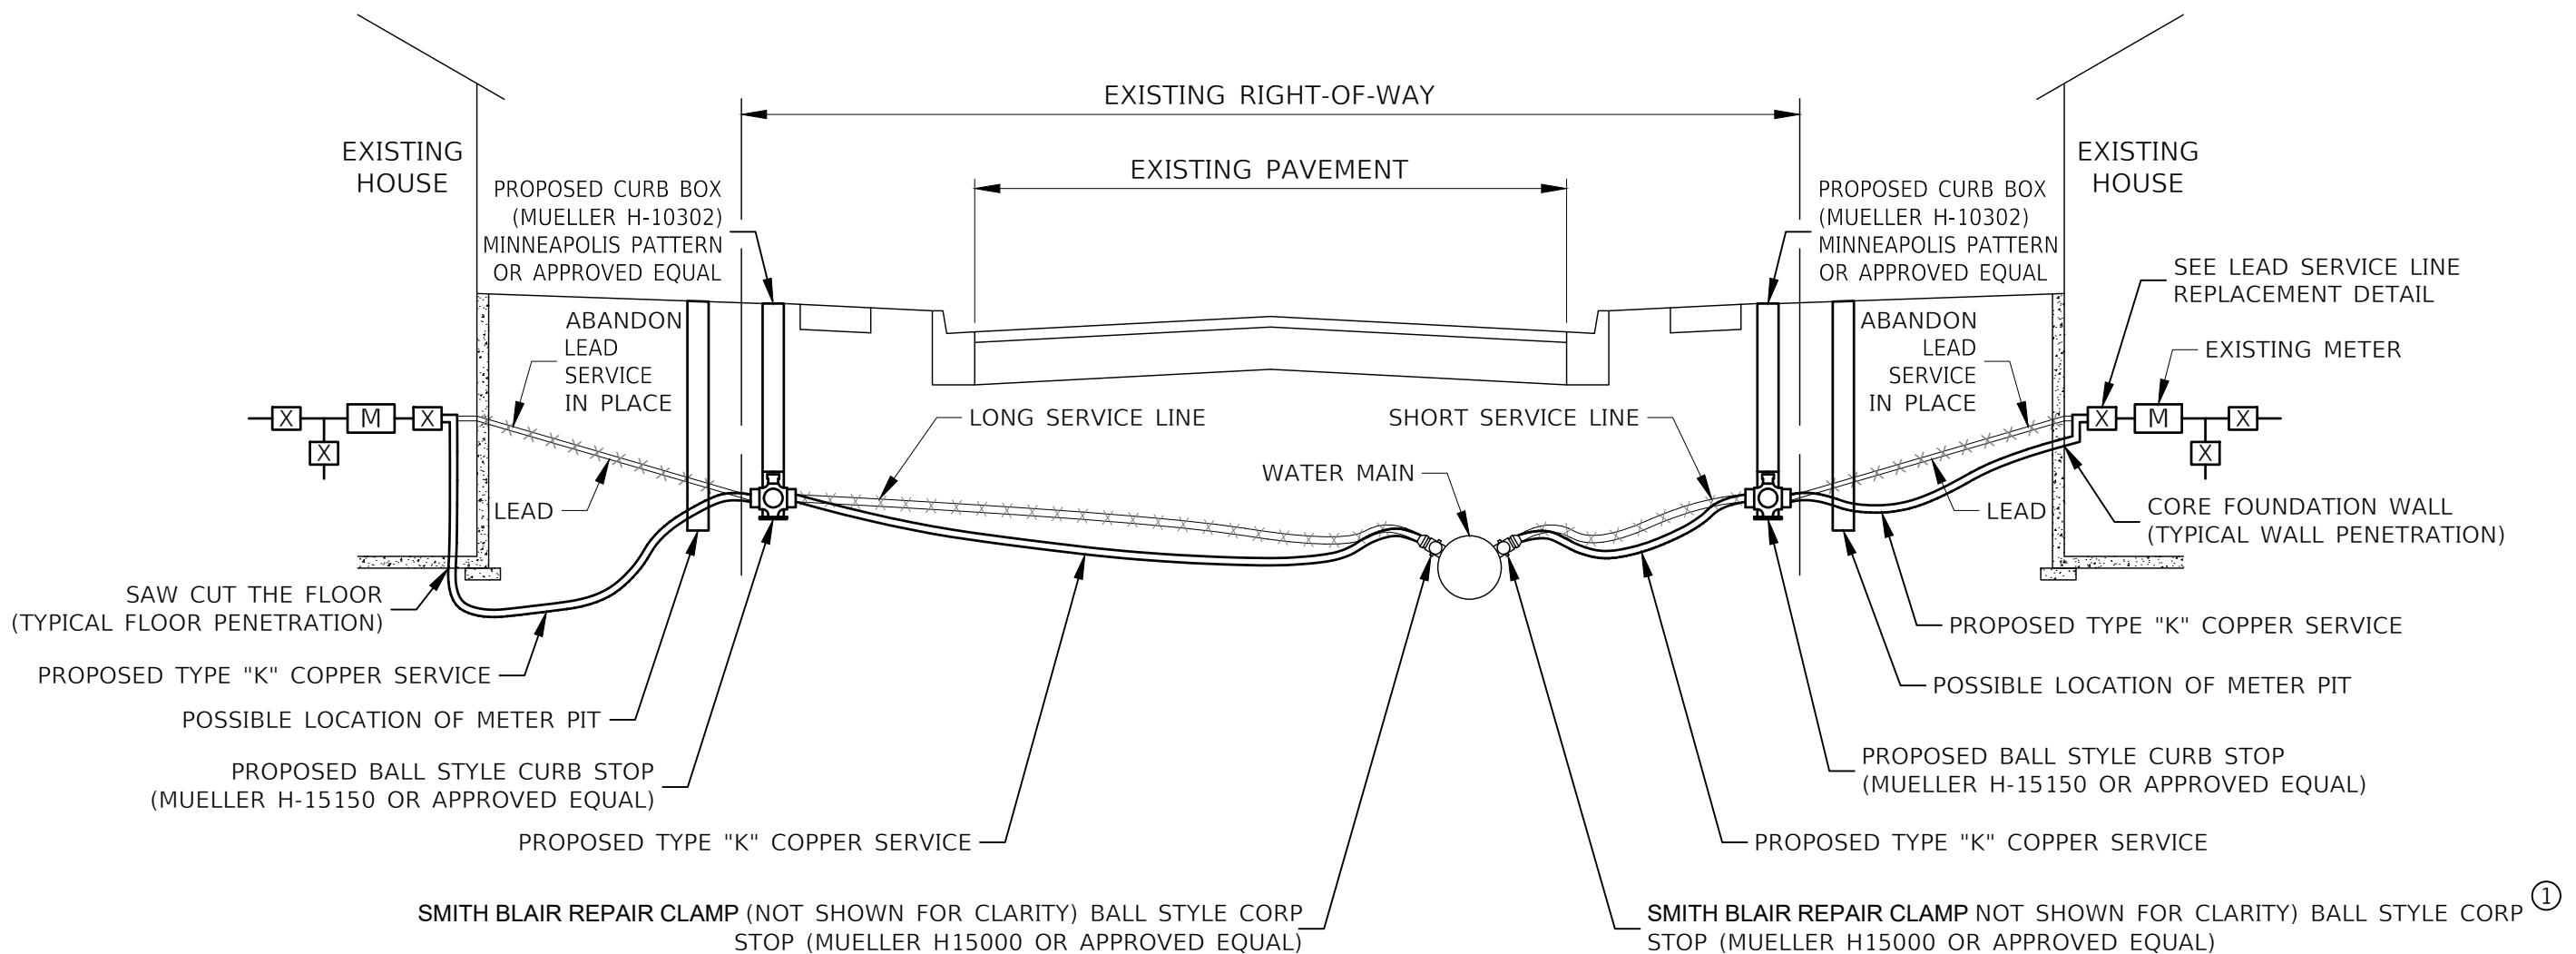

NOTE:
 (1) SEE SPECIFICATIONS FOR WATER MAIN TAPPING.


FULL LEAD WATER SERVICE REPLACEMENT
(COPPER)

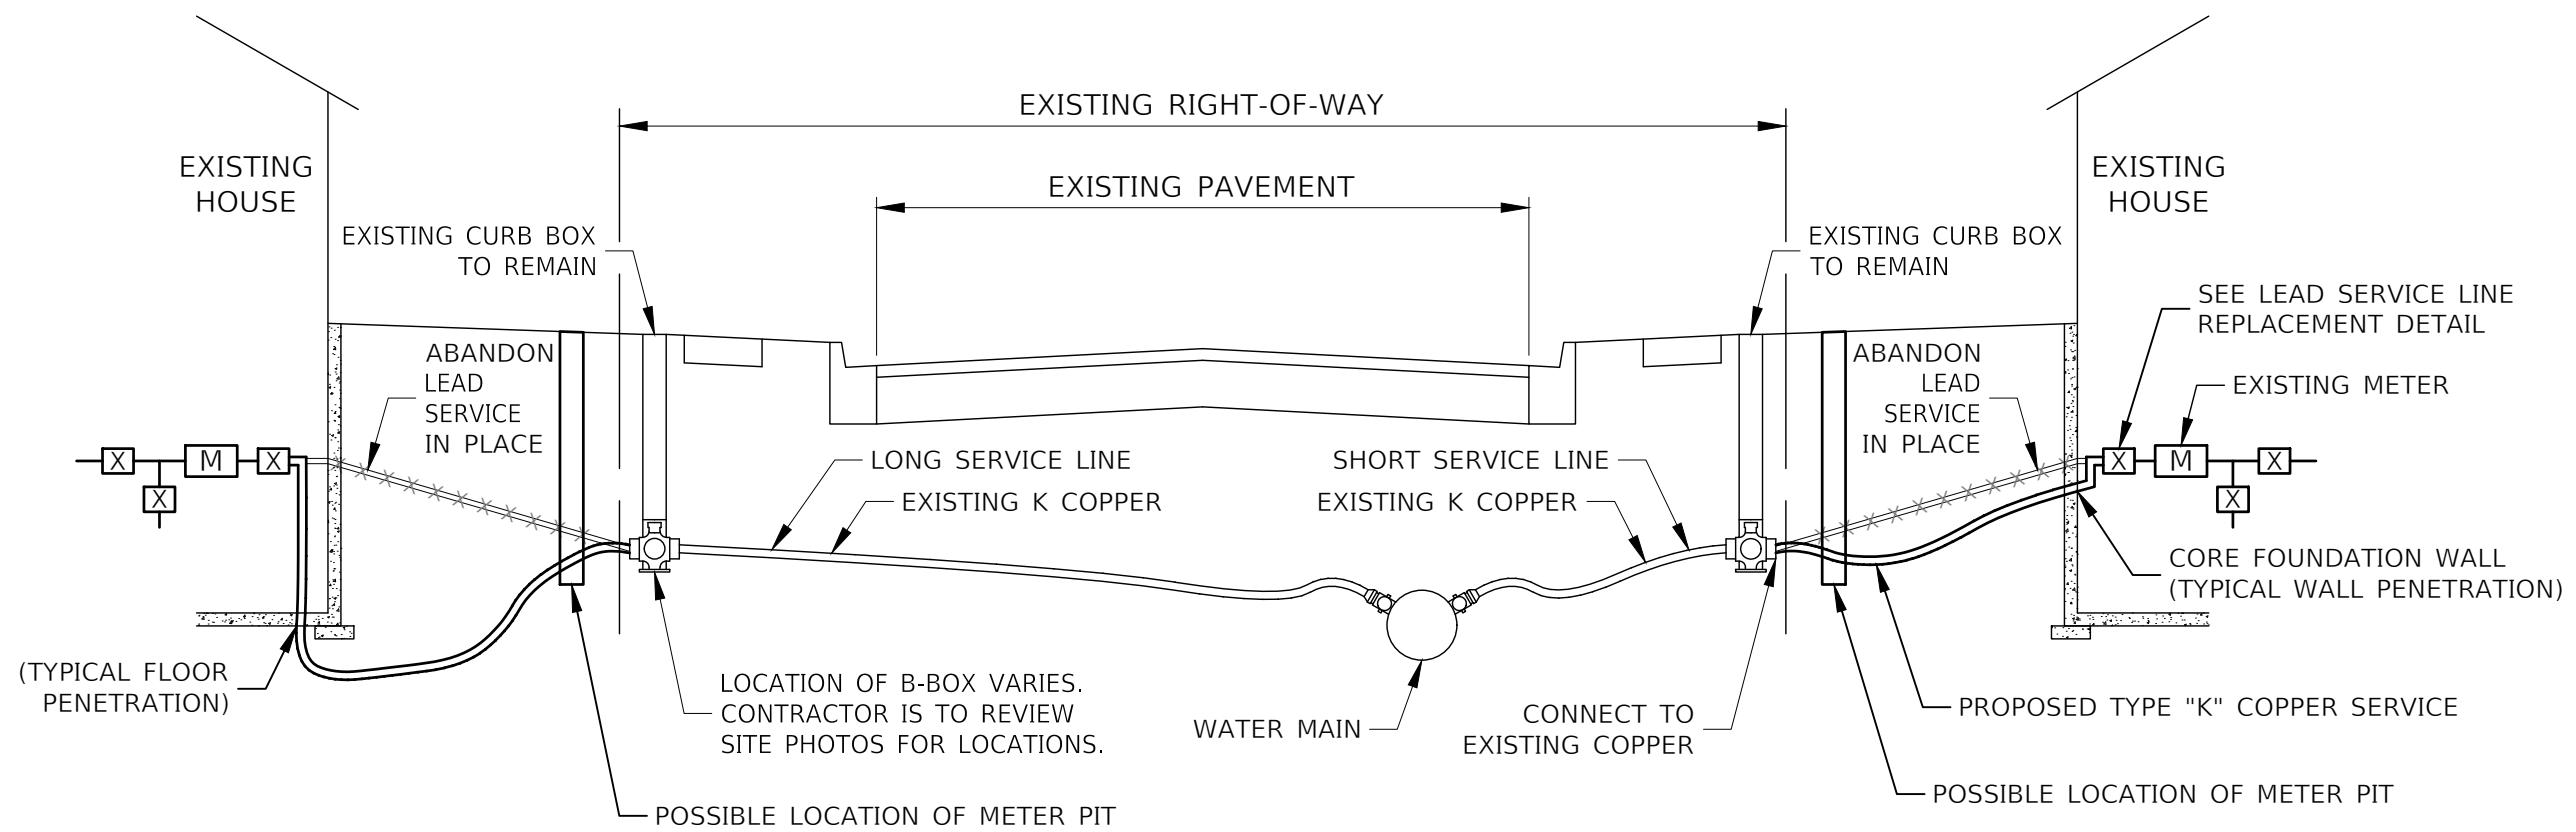

NOTE:

- ① ONLY CURB BOXES THAT ARE NOT FUNCTIONING ARE TO BE REPLACED PER THE SPECIAL PROVISIONS. ANY CURB BOXES THAT ARE BURIED SHALL BE ADJUSTED PER THE SPECIAL PROVISIONS.

	PARTIAL LEAD WATER SERVICE REPLACEMENT PRIVATE SIDE (COPPER)
--	---

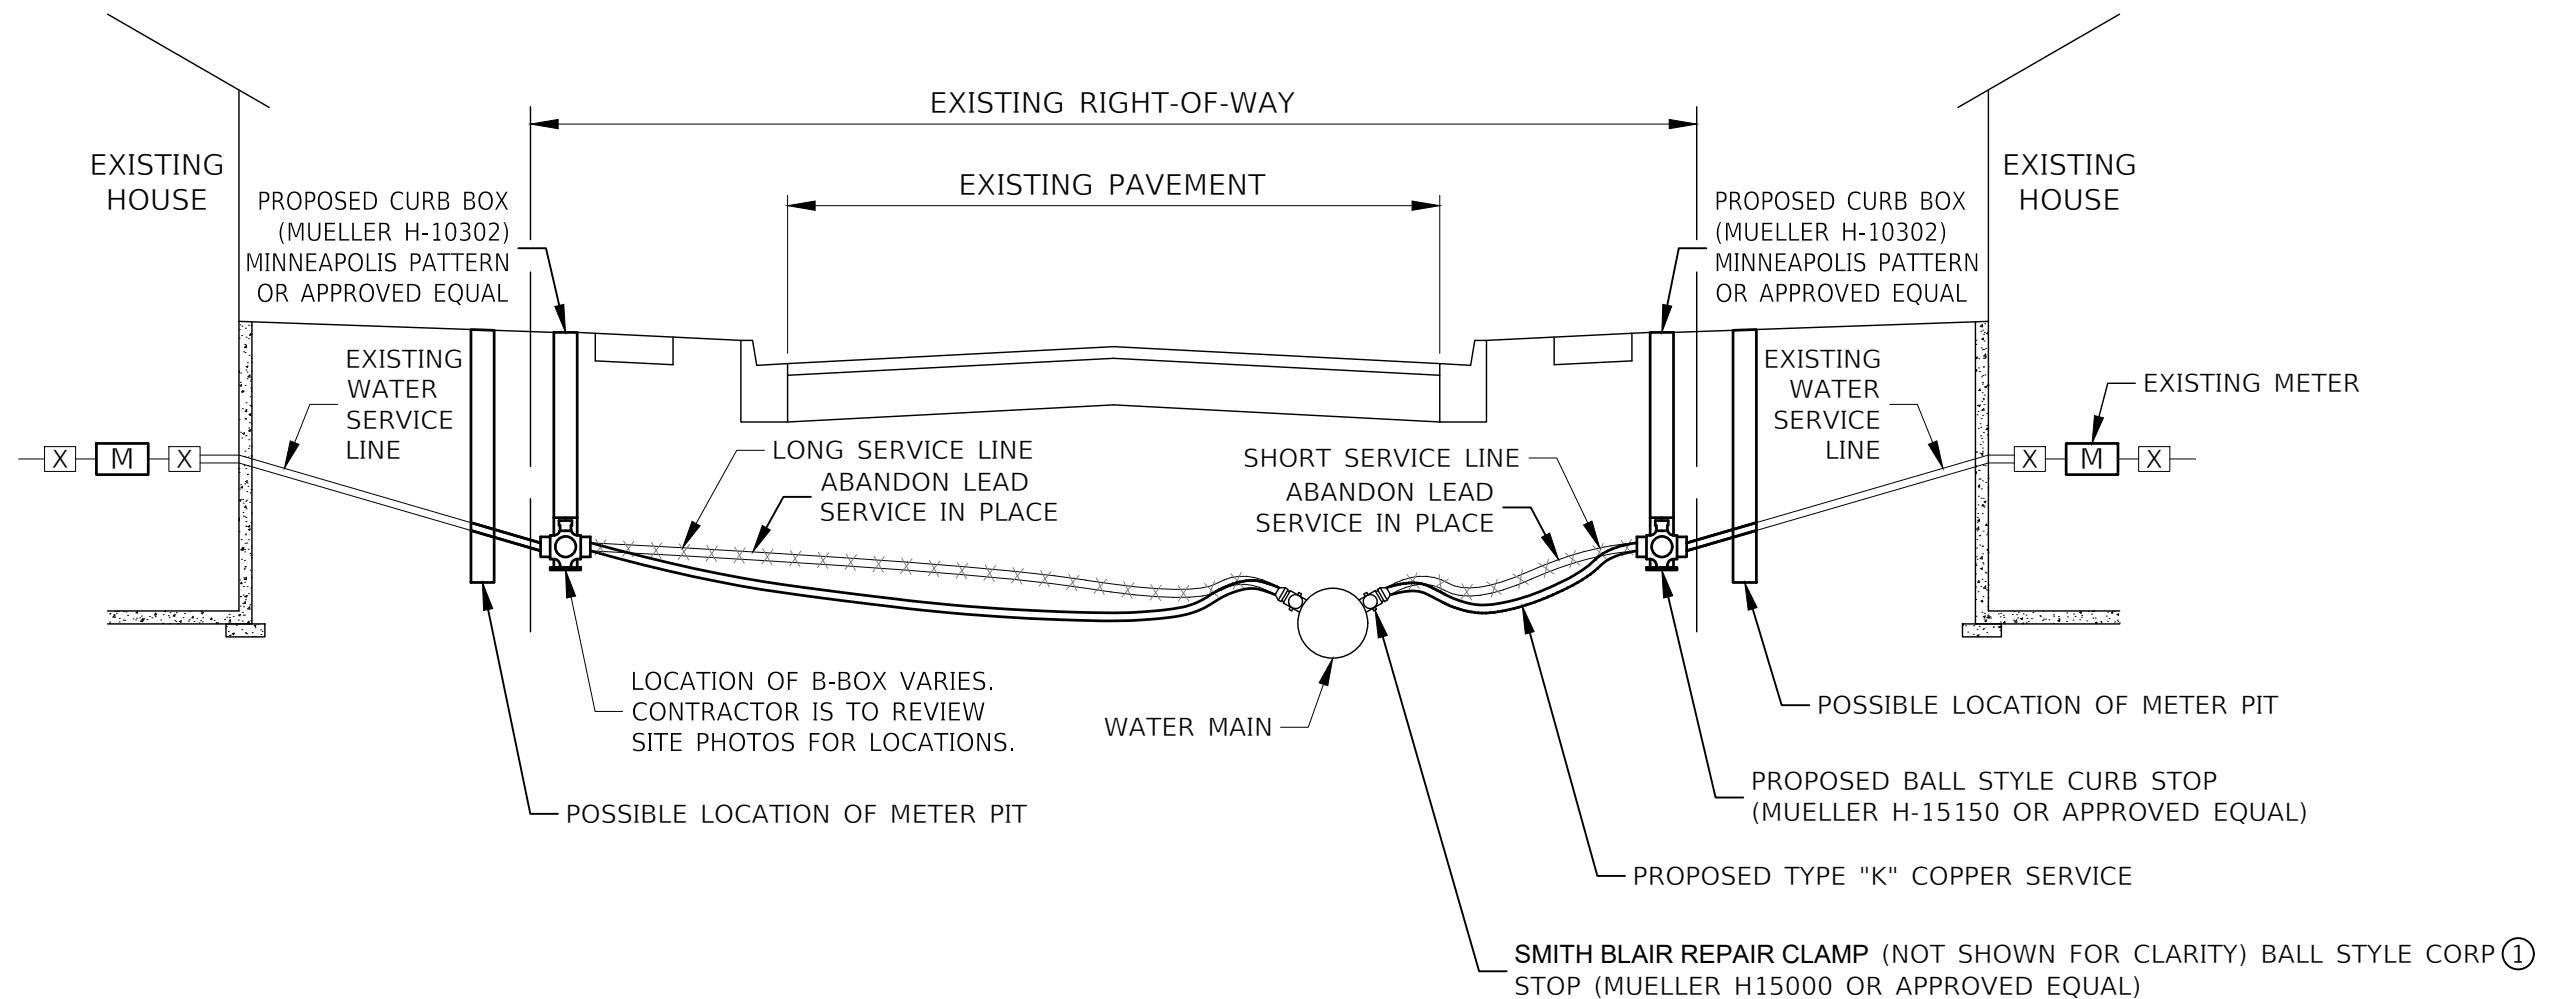

NOTE:
① SEE SPECIFICATIONS FOR WATER MAIN TAPPING.

PARTIAL LEAD WATER SERVICE REPLACEMENT
PUBLIC SIDE (COPPER)

Appendix 6

Lead Service Line Replacement Outreach Materials

Bold (and foreign languages) must remain as-is. Normal font can be modified.

This notice contains important information about your water service and may affect your rights. We encourage you to have this notice translated in full into a language you understand and before you make any decisions that may be required under this notice.

Diese Mitteilung beinhaltet wichtige Informationen über Ihre Wasserversorgung und könnte Ihre Rechte beeinflussen. Wir bitten Sie, dass Sie diese Mitteilung vollständig in eine Sprache übersetzen lassen, die Sie verstehen, bevor Sie eventuelle Entscheidungen treffen, welche im Zusammenhang mit dieser Benachrichtigung erforderlich sind.

Ang abisong ito ay naglalaman ng mahalagang impormasyon tungkol sa iyong serbisyo sa tubig at maaaring makaapekto sa iyong mga karapatan. Hinilikayat namin kayo na isalin nang buo ang abisong ito sa wikang naiintindihan ninyo at bago kayo gumawa ng anumang mga desisyon na maaaring kailanganin sa abisong ito.

આ સૂચનામાં તમારી પાણીની સેવા વિશે મહત્વપૂર્ણ માહિતી શામેલ છે અને તમારા અધિકારોને અસર કરી શકે છે. અમે તમને પ્રોત્સાહિત કરીએ છીએ કે તમે આ સૂચના હેઠળ જરૂરી હોય તેવા કોઈપણ નિર્જયો લો તે પહેલાં તમે આ સૂચનાને તમે સમજો છો તે ભાષામાં સંપૂર્ણ ભાષાતર કરો.

Niniejsze zawiadomienie zawiera ważne informacje na temat Państwa przyłącza wodociągowego i może mieć wpływ na Państwa prawa. Przed podjęciem jakichkolwiek decyzji, które mogą być wymagane na mocy niniejszego zawiadomienia, zachęcamy Państwa do przetłumaczenia całości niniejszego zawiadomienia na język, który będzie dla Państwa zrozumiałym.

يحتوي هذا الإشعار على معلومات مهمة حول خدمة المياه لديك، وقد يؤثر على حقوقك. قبل اتخاذ أي قرارات قد تكون مطلوبة بمحض
هذا الإشعار فإننا نشجعك على ترجمته بالكامل إلى لغة تفهمها.

اس نوئس میں آپ کی پانی کی سروسرز سے متعلق ابم ترین معلومات موجود ہیں اور یہ آپ کے حقوق کو متاثر کر سکتا ہے۔ ہم آپ کو ترغیب دیں گے کہ آپ اس نوئس کا مکمل طور پر اس زبان میں ترجمہ کروائیں جو آپ سمجھتے ہوں اور ممکن ہے کہ آپ کے کوئی فیصلہ لینے سے قبل اس نوئس کے تحت یہ درکار بھی ہو۔

Este aviso contiene información importante sobre su servicio de agua y puede afectar sus derechos. Lo animamos a que traduzca este aviso a un idioma que comprenda antes de tomar cualquier decisión que pueda ser necesaria en virtud del mismo.

|b| 통지서에는 귀하의 권리에 영향을 미칠 수 있는 수도 서비스에 관한 중요한 정보가 제시되어 있습니다. 이 통지서에서 요구하는 결정을 내리기 전에 이 통지서를 귀하가 이해할 수 있는 언어로 번역하시기 바랍니다.

|本通知包含有关您的供水服务的重要信息，可能会影响到您的权利。在您做出本通知所要求的任何决定之前，我们鼓励您将本通知完整地翻译成您可理解的语言。

IMPORTANT INFORMATION ABOUT LEAD IN YOUR DRINKING WATER

The Community Water System (CWS) has determined that your property is likely serviced by a lead water pipe. Lead can cause serious health problems, especially for pregnant women and children 6 years and younger. Please read this notice closely to see what you can do to reduce lead in your drinking water.

The CWS provides water that protects our residents from lead leaching into our water system. The CWS has not had a recent violation for lead levels. However, proper maintenance of the system to prevent the leaching of lead costs time, energy, and money. There is also the potential that something might go wrong and people with lead service lines would be exposed to lead in their drinking water.

Health Effects of Lead

It can cause damage to the brain and kidneys, and can interfere with the production of red blood cells that carry oxygen to all parts of your body. The greatest risk of lead exposure is to infants, young children, and pregnant women. Scientists have linked the effects of lead on the brain with lowered IQ in children. Adults with kidney problems and high blood pressure can be affected by low levels of lead more than healthy adults. Lead is stored in the bones and can be released later in life. During pregnancy, the child receives lead from the mother's bones, which may affect brain development.

Sources of Lead

The source of water from Lake Michigan does not contain lead. When water is in contact with service lines or plumbing that contains lead for several hours, the lead may enter drinking water. Homes built before the 1960s in our community are more likely to have lead service lines and lead in solder and plumbing fixtures.

Don't forget, most lead exposure is still from small children ingesting lead paint, dust, and soil. In addition, lead can be found in certain types of pottery, pewter, brass fixtures, food, and cosmetics. Other sources include exposure in the work place and exposure from certain hobbies (lead can be carried on clothing or shoes). Lead is found in some toys, some playground equipment, and some children's metal jewelry. Wash your children's hands and toys often as they can come into contact with dirt and dust containing lead.

Steps That You Can Take to Reduce Your Exposure to Lead in Your Drinking Water

1. *Run your water to flush out lead.*
 - a. If the plumbing in your home is accessible; you may be able to inspect your own plumbing to

- determine whether you have a lead service line. Otherwise, you will most likely have to hire a plumber, or allow the Village to inspect your water line.
- b. If you do not have a lead service line, running the water for 1 - 2 minutes at the kitchen tap should clear the lead from your household plumbing to the kitchen tap. Once you have done this, fill a container with water and store it in the refrigerator for drinking, cooking, and preparing baby formula throughout the day.
 - c. If you do have a lead service line, flushing times can vary based on the length of your lead service line and the plumbing configuration in your home. The length of lead service lines varies considerably.
 - d. The following flushing guidelines are recommended by the American Water Works Association after a lead service line is replaced:
 - i. Find all the faucets that will drain, including the basement and all floors in your house.
 - ii. Remove aerators and screens whenever possible, including the shower heads, from all faucets you plan to flush.
 - iii. Include the laundry tubs, hose-bibs, bathtubs, and showers as flushing points.
 - iv. After all the aerators are off, open the faucets in the basement or lowest floor in the house. Leave all faucets running at highest rate possible, using cold water.
 - v. After the faucets are all open in lowest floor, open the faucets on next highest floor of the house. Continue until faucets are open on all floors.
 - vi. After all faucets are opened, leave the water running for at least 30 minutes.
 - vii. After 30 minutes, turn off the first faucet you opened and continue to turn off other faucets in the same order you turned them on.
 - viii. Clean aerators/screens at each faucet. You may need to replace screens/aerators if too old or worn
2. *Use cold water for drinking, cooking, and preparing baby formula.*
 - a. Do not cook with or drink water from the hot water tap; lead dissolves more easily into hot water.
 - b. Do not use water from the hot water tap to make baby formula.
 3. *Look for alternative sources or treatment of water.*
 - a. You may want to consider purchasing bottled water; or
 - b. Purchase a water filter that is certified to remove "total lead". The filter should be NSF 53 and NSF 42 certified.
 4. *Clean and remove any debris from faucet aerators on a regular basis.*
 5. *Do not boil water to remove lead.* Boiling water will not reduce lead.
 6. *Purchase lead free faucets and plumbing components.*
 7. *Remove the entire lead service line.*
 - a. *As part of the separate Lead Service Line Replacement program, should you agree to participate, the Village will replace your lead service line from the water main to the meter inside your home.*
 8. *Test your water for lead.*
 - a. Call us at: 815-412-2015 to find out how to get your water tested for lead. While we do not do the testing, we can provide a list of laboratories certified to do the testing. Laboratories will send you the bottles for sample collection. Please note that we are not affiliated with the laboratories, and they will charge you a fee.
 - If test results indicate a lead level above 15 ug/L, bottled water should be used by pregnant women, breast- feeding women, young children, and formula-fed infants.
 - b. Approximately one month after service line replacement, testing is recommended. The sample should be a first-draw sample after water has not been used for at least 6 hours. The sample must be collected from a tap used frequently inside the home, preferably from the kitchen.
 - c. As a precaution, until the sample is collected and analyzed, the customer is recommended to do a mini-flush of premise plumbing by running tap water each morning or when the water sits in the pipe for at least 6 hours. Flush for 5 minutes to displace water that has been sitting in the pipes inside the house and in the service line. This could include taking a shower, running the dishwasher, flushing a toilet, collecting water for plants/garden, or running the faucet. The customer should do this before using any

water for drinking, cooking, infant formula, and so on. Daily miniflushes should continue for six months or until lead sample results show the lead level is below the regulatory guideline. The customer should clean debris from aerators and screens once a month for six months. After six months, clean debris twice a year.

For More Information

Call us at () or visit our website at (). For more information on reducing lead exposure around your home/building and the health effects of lead, visit EPA's website at www.epa.gov/lead or contact your health care provider.

Thank you for reading this notice, and we hope to hear from you soon.

Salutation